S E R V I C E N O T E

SUPERSEDES: None

33120A Function Generator / Arbitrary Waveform Generator

Serial Numbers: US00000000 / US 34017350

RS-232 communication error transmitted by the 33120A

Duplicate Service Notes:

33120A-02 34401A-07 34420A-01

Situation:

The 33120A may transmit invalid characters over the RS-232 communication link. This problem is limited to 33120A units with the following revision code:

XX-03-XX XX-04-XX

If parity is turned "off" all transmissions are correct. With parity set to "ODD" or "EVEN"; characters in the decimal range of 121 through 127 will not transmit correctly. This range includes "y", "z" and some miscellaneous characters that are not normally transmitted. This problem does not effect any numeric responses but can be observed in responses from certain query commands, such as SYSTem:ERRor?, DISPlay:TEXT?, and CALibration:STRing?.

Continued

DATE: May 1996

ADMINISTRATIVE INFORMATION

SERVICE NOTE CLASSIFICATION:		
MODIFICATION RECOMMENDED		
ACTION CATEGORY:	☐ IMMEDIATELY ■ ON SPECIFIED FAILURE ☐ AGREEABLE TIME	STANDARDS: Labor 1.0 Hour
LOCATION CATEGORY:	■ CUSTOMER INSTALLABLE■ ON-SITE■ SERVICE CENTER	SERVICE RETURN USED RETURN INVENTORY: SCRAP SEE TEXT SEE TEXT
AVAILABILITY:	PRODUCT'S SUPPORT LIFE	AGILENT RESPONSIBLE UNTIL: May 1998
AUTHOR: REM	ENTITY: 0940	ADDITIONAL INFORMATION:

© 1996 AGILENT TECHNOLOGIES PRINTED IN U.S.A.



This problem does not occur when using the GPIB communication link.

Solution/Action:

(Applies only to units utilizing the RS-232 communication link.)

1. Determine if units has the REV code XX-03-XX or XX-04-XX. This information can be obtained from using the following front panel command: (Turn unit off and then on.)

```
Key Stroke Display
Shift (Blue key), "ENTER" A:MEAS MENU
"" F:CAL MENU
"" E:I/O MENU
"" D:SYS MENU
"V" 1:RDGS STORE
"" 6:REVISION
"V" REV XX-??-XX
```

2. If the unit has the XX-03-xx or XX-04-XX revision code then operate the unit with parity turned "off" or return the unit to factory for an upgrade.