34465A-06

# Modification Recommended Service Note

Supersedes: NONE

# 34465A Digital Multimeter, 61/2 Digit

Serial Numbers: MY54500151- MY60016557 / SG54500102 - SG59018231

The Problem – Failure due to front panel loose issue.

<b>Parts Required:</b> P/N	Description	Qty.
0515-1114	Screw	4
3050-0893	Washer	4

#### ADMINISTRATIVE INFORMATION

ACTION CATEGORY:	[X] ON SPECIFIED FAILURE [[]] AGREEABLE TIME	STANDARDS LABOR: 1 Hour
LOCATION CATEGORY:	<ul> <li>[X] CUSTOMER INSTALLABLE</li> <li>[]] ON-SITE (active On-site contract required)</li> <li>[X] SERVICE CENTER</li> <li>[]] CHANNEL PARTNERS</li> </ul>	SERVICE: [[]] RETURN USED [[]] RETURN INVENTORY: [[]] SCRAP PARTS: [[]] SCRAP [X] SEE TEXT [X] SEE TEXT
AVAILABILITY	': PRODUCT'S SUPPORT LIFE	NO CHARGE AVAILABLE UNTIL: 26 Jan 2023
	[X] Calibration Required [[]] Calibration NOT Required	PRODUCT LINE: GM AUTHOR: WY

ADDITIONAL INFORMATION:



## Situation:

A loose front panel could cause communication error between front panel board and main board. When this happens, instrument might exhibit the following failure/error message:

- "Firmware update failed. Current version is A.OX.XX" error message.
- Unable to power on
- White screen
- Display failure
- Unit hang/lock up
- Application error ("Application Torreys.exe encountered a serious error and must shut down" error message)

### Solution/Action:

The failure caused by a loose front panel can be resolved by securing the front panel with 4 screws and 4 washers at both sides of the front panel.

The steps below are also applicable to unit with a detached front panel.

Perform the following to resolve the issue:

- 1. Order the required parts.
- 2. Remove and then reassemble the front panel.
- 3. Secure the front panel with 2 screws and washers at each side of the front panel.



- 4. Power on the instrument and check if failure persists.
- 5. If the failure has been resolved, proceed for calibration by following the calibration procedures mentioned on the service guide.
- 6. If the failure persists, this indicates that the instrument needs to be repaired/exchanged.

Date	Service Note Revision	Author	Reason for Change	
26 Jan 2022	01	WanYee	As Published	