# S E R V I C E N O T E

SUPERSEDES: NONE

## 35670A Dynamic Signal Analyzer

Serial Numbers: 0000A00000/3613A03191

### Catalog of disk remains displayed after disk is ejected

To Be Performed By: Agilent-Qualified Personnel

#### Parts Required:

**P/N Description Quantity** 35670-69507 CPU assembly 1

#### **Situation:**

The catalog display of a floppy disk contents should go away if the floppy disk is removed while the catalog is being displayed. In some rare cases this may not happen and the only way to make the catalog display go away will be to cycle the instruments power.

#### **Solution / Action:**

The CPU assembly should be replaced in instruments experiencing this problem. The disk eject sensing circuit on the CPU assembly has been modified to correct this problem. Refer to the 35670A Service Manual for instructions on replacing the CPU assembly (35670-69507).

DATE: March 1999

### **ADMINISTRATIVE INFORMATION**

SERVICE NOTE CLASSIFICATION:				
MODIFICATION RECOMMENDED				
ACTION CATEGORY:	☐ IMMEDIATELY ☐ ON SPECIFIED FAILURE ☐ AGREEABLE TIME	STANDARDS: LABOR 1.0 Hours		
LOCATION CATEGORY:	☐ CUSTOMER INSTALLABLE☐ ON-SITE☐ SERVICE CENTER	SERVICE INVENTORY:	☐ RETURN ☐ SCRAP ☐ SEETEXT	USED RETURN PARTS: SCRAP SEETEXT
AVAILABILITY:	PRODUCT'S SUPPORT LIFE	AGILENT RESPONSIBLE UNTIL: March 2001		
AUTHOR: DLC	ENTITY: A100	ADDITIONAL INFORMATION: A1-9712008		

© 1999 AGILENT TECHNOLOGIES PRINTED IN U.S.A.

