# S E R V I C E N O T E

SUPERSEDES: None

## 3764A Digital Transmission Analyzer

**Serial Numbers:** 2847U02888 / 9999U99999

### To Improve Return Loss on Options 001, 005 and 006

Parts Required:

**Part No. Description** 9170-0817 Ferrite Bead

#### **Situation:**

The HDB3 options of the 3764A exhibit poor return loss when rates of 34Mb/s and lower are selected. This is caused by the stray capacitance of a long trace carrying the HDB3 signal on the A11 board, and can be corrected by adding inductance in the form of a ferrite bead to the in-line fuse, F1 on the 03764-60411 assembly.

#### **Solution/Action:**

Add ferrite bead 9170-0817 on the 3764-60522 assembly.

DATE: October 1995

### ADMINISTRATIVE INFORMATION

SERVICE NOTE CLASSIFICATION:		
MODIFICATION RECOMMENDED		
ACTION CATEGORY:	☐ IMMEDIATELY ■ ON SPECIFIED FAILURE ☐ AGREEABLE TIME	STANDARDS: Labor 1.0 Hour
LOCATION CATEGORY:	☐ CUSTOMER INSTALLABLE ☐ ON-SITE ☐ SERVICE CENTER	SERVICE RETURN USED RETURN INVENTORY: SCRAP SEE TEXT SEE TEXT
AVAILABILITY:	PRODUCT'S SUPPORT LIFE	AGILENT RESPONSIBLE UNTIL:
AUTHOR: PAC	ENTITY: 1400	ADDITIONAL INFORMATION:

© 1995 AGILENT TECHNOLOGIES PRINTED IN U.S.A.

