

S E R V I C E N O T E

SUPERSEDES: None

HP 37732A Telecom Analyzer

Serial Numbers: 0000U00000/9999U99999

Retrofit Instructions for the Datacom Lid**Situation :**

Instruments before serial number 3606U will not have a pocket cut in the casting to affix the ground strap for the lid. Paint must be removed from the casting, so that a good ground connection can be made around the area of the screw hole which is nearest to the ground strap.

Four screws are required to fit the lid to the parent instrument; three of these are the same screw 0515-1112, if they are before 3606U and 0515-1111 after 3606U. In both cases use washer 3050-0100 supplied and fit the washer between the screw and the braiding.

This exchange assembly has part number 15901-69020 and will take the place of the old board exchange number 15901-69001 once all the stock of this part has been upgraded. This change will make for much easier exchange and give better and more reliable measurements due to the improved RFI screening.

DATE: March 1997

ADMINISTRATIVE INFORMATION

SERVICE NOTE CLASSIFICATION:

INFORMATION ONLY

AUTHOR:

GS

ENTITY:

1400

ADDITIONAL INFORMATION: