

3960-3A

S E R V I C E N O T E

SUPERSEDES

3960-3

Model: All 3960 Series #941
Serial # 00101 to 00120 and
00122, 00125, 00126,
00137, 00138, 00139,
and 00141
Date: 19 Aug. 1970
File No. 42-087

Subject: 3960 Servo Amplifier Card (A-9) Capacitor
C-3, Incorrect Installation.

Note: This Service Note corrects Service Note 3960-3.

Discussion: There is a possibility that A9C-3, a 50V
5 microfarad electrolytic capacitor, has
been installed incorrectly on all the above
listed 3960 tape units. The negative (-)
side of the capacitor should be connected to
the junction of R-1 (4.64K Resistor), and R-2
(100 ohm Resistor). The positive (+) side
should be connected to the circuit board
common, (pin 5 of the etched circuit connector).

Implementation: If capacitor A9C-3 is incorrectly installed,
make the necessary corrections as indicated
above. Refer to 3960 Service Manual, Figure 11-11,
Page 11-12 for proper location and mounting of A9C-3.

Parts Affected: A9C-3 - 50 microfarad capacitor fixed aluminum

BW/ps/WA

HEWLETT  PACKARD

For more information, call your local HP Sales Office or East (201) 261-5000 • Midwest (312) 677-0486 • South (404) 436-6181
West (213) 877-1282. Or, write: Hewlett-Packard, 1501 Page Mill Road, Palo Alto, California 94304. In Europe, 1217 Meyrin-Geneva

Printed in U.S.A.