S E R V I C E N O T E

SUPERSEDES: None

41501A SMU and Pulse Generator Unit Expander

Serial Numbers: JP10A00101 / JP10A00140, JP10A10101/JP10A10121 or JP10A50101/JP10A50149

Duplicate Service Notes:

4155A-02 4156A-02

Power supply module replacement to prevent shut-down failures

To Be Performed by: Agilent-Qualified Personnel

Parts Required:

Part No. Qty. Description

41501-69003 1 Power Supply Module (for the 41501A)

Continued

DATE: August 1994

ADMINISTRATIVE INFORMATION

| SERVICE NOTE CLASSIFICATION: | | |
|------------------------------|---|---|
| MODIFICATION RECOMMENDED | | |
| ACTION CATEGORY: | ☐ IMMEDIATELY ■ ON SPECIFIED FAILURE ☐ AGREEABLE TIME | STANDARDS: Labor 0.5 Hours |
| LOCATION CATEGORY: | ☐ CUSTOMER INSTALLABLE☐ ON-SITE☐ SERVICE CENTER | SERVICE |
| AVAILABILITY: | PRODUCT'S SUPPORT LIFE | AGILENT RESPONSIBLE UNTIL: September 1997 |
| AUTHOR: IT | ENTITY: 3301 | ADDITIONAL INFORMATION: |

© 1994 AGILENT TECHNOLOGIES PRINTED IN U.S.A.



Situation:

The 4155A/4156A/41501A units within the listed serial number range, and having a power supply module with an EDC (Engineering Date Code) less than 3424, may have a power supply shut-down problem. This problem shows the following phenomena.

- Units hang up during the power on selftest.
- CAUTION 308: Unknown emergency (SMUC time out) is displayed intermittently during the operation.
- During the operation, power of the units is cycling and all LEDS on the front panel will be flashing.

Solution/Action:

Replace a faulty power supply module of the units using an exchange program. Power supply modules with an EDC equal to 3424 or greater have been modified at the factory, and SMO/SME already stocks the modified supply modules as an exchange part.

An EDC is in the form YYWW and is usually found on a white label on the side panel of power supply modules.

```
Where: YY=YEAR-1960 (Example: If YY=33, the year is 1993)
```

WW=WEEK (Example: If WW=20, it indicates the 20th week of YY)

Following shows an example of a label that lists an EDC.

```
04155-60003
33-3424 << 3424 is the EDC
00484-3427
MADE IN JAPAN
```

If the 4155A/4156A has the 41501A expander, it is required to replace both power supplies of the 4155A/4156A and 41501A.