S E R V I C E N O T E

SUPERSEDES: None

4155A Semiconductor Parameter Analyzer

Serial Numbers: JP00000000 / JP10A00253

Motherboard replacement for SMU Selftest/Selfcalibration Error 10x24

To Be Performed by: Agilent-Qualified Personnel

Parts Required:

Part No. Qty. Description

04155-66508 1 Motherboard

Situation:

The SMU Selftest/Selfcalibration Error 10x24 (10124, 10224, 10324, or 10424) may occur. This error occurs in any or all of the following executions, and may occur intermittently.

- Power-on Selftest
- Selftest
- Selfcalibration (Auto-Selfcalibration)

Continued

DATE: October 1994

ADMINISTRATIVE INFORMATION

SERVICE NOTE CLASSIFICATION:		
MODIFICATION RECOMMENDED		
ACTION CATEGORY:	☐ IMMEDIATELY ■ ON SPECIFIED FAILURE ☐ AGREEABLE TIME	STANDARDS: Labor 2.0 Hours
LOCATION CATEGORY:	☐ CUSTOMER INSTALLABLE☐ ON-SITE☐ SERVICE CENTER	SERVICE RETURN USED RETURN INVENTORY: SCRAP PARTS: SCRAP SEE TEXT SEE TEXT
AVAILABILITY:	PRODUCT'S SUPPORT LIFE	AGILENT RESPONSIBLE UNTIL: October 1997
AUTHOR: MN	ENTITY: 3301	ADDITIONAL INFORMATION:

© 1994 AGILENT TECHNOLOGIES PRINTED IN U.S.A.



Solution/Action:

Replace the Motherboard.

The improved Motherboard has the Engineering Date Code (EDC) of 3428 or greater, which is used from the Serial Number JP10A00254. The EDC label is on the back of the MotherBoard. The MotherBoard before the improvement does not have the EDC label.

+-----+
| 04155-66508 |
| 33-3428 |
| ^^^^ |
| 00192-3435 |
| MADE IN JAPAN |
+------+

"3428" is an EDC.