							41	55A	-13
S E	R	V	Ι	С	Е	Ν	0	Т	Е
					SU	PERSEDE	S: None		
4155A Sen 04155-665					v				
Serial Numbo	ers: See	e below.							
Firmware u	update	to fix S	SMU gl	litch pr	oblem				
Duplicate Ser	rvice No	otes:							
4155A-13 4156A-14	Serial Numbers: 0000A00000/9999Z99999 Serial Numbers: 0000A00000/9999Z99999								
To be Perform	med by	: Agilent-	qualifie	d person	nel				
Parts Require	ed:								
P/N		Descript	ion		Quantity				
04155-85235		SMUC I	ROM 1.	.11	1				
Situation:									
Unexpected voVoltage sw	•	•		•			owing cor	nditions.	
Auto range10 nA or lo			•		weep is finish	ed			
		ige is used		onage s		cu.		Continue	ed
					ПА	TE: Septer	nher 190	18	
					DF	i L. Ochiel	1001 133	.0	

ADMINISTRATIVE INFORMATION

SERVICE NOTE CLASSIFICATION: MODIFICATION RECOMMENDED								
ACTION CATEGORY:	 IMMEDIATELY ON SPECIFIED FAILURE AGREEABLE TIME 	STANDARDS: LABOR 0.5 Hours						
LOCATION CATEGORY:	 ☐ CUSTOMER INSTALLABLE ☐ ON-SITE ■ SERVICE CENTER 	SERVICE RETURN USED RETURN INVENTORY: SCRAP PARTS: SCRAP SEE TEXT SEE TEXT SEE TEXT						
AVAILABILITY:	PRODUCT'S SUPPORT LIFE	AGILENT RESPONSIBLE UNTIL: July 2000						
AUTHOR: MO	ENTITY: 3300	ADDITIONAL INFORMATION: None						

© 1998 AGILENT TECHNOLOGIES PRINTED IN U.S.A.



Solution/Action:

Update the SMU controller (SMUC) firmware to 1.11 by replacing the SMUC ROM on the 04155-66501/04155-69501 CPU Assembly. For replacement procedure, see "Replacement Procedures" in the 4155A/4156A Service Manual (P/N 04155-90600). The HOSTC firmware revision need not be changed.

ROM New Revision P/N SMUC 04155-85235 (1.11)

To do this replacement, 41501A, B SMU/PGU Expander is not necessary.