4396B-05

S	Е	R	V	I	С	Е	Ν	0	Т	Е	
4	SUPERSEDES: None 4396B Network/Spectrum/Impedance Analyzer										
S	Serial Numbers: 4396B: JP1KE00387 / JP1KE00421										
	Use of GSP PN E4970-66552 and LCD PN 2090-0574 may cause a display problem										
Т	To Be Performed By: Agilent-Qualified Personnel										
P	Parts Required:										
P	/N		Desc	ription	l	Quant	tity				
E	4970-6655	54	GSP			1					
Si	Situation:										
te	An intermittent display problem (all white image is displayed continuously) may happen after power on. The configuration of old GSP Board PN E4970-66552 and LCD PN 2090-0574 may cause this problem.										
S	Solution / Action:										
	When the GSP board with P/N E4970-66552 becomes defective, P/N E4970-66554 must be used to replace it.										
	DATE: July 1998										

## ADMINISTRATIVE INFORMATION

SERVICE NOTE CLASSIFICA	TION:							
INFORMATION ONLY								
AUTHOR:	ENTITY:	ADDITIONAL INFORMATION:						
IT	3355							
© 1998 AGILENT TECI PRINTED IN U.S.A.	HNOLOGIES	Agilent Technologies						