

Supersedes:

None

HP MODEL 5345A ELECTRONIC COUNTER**Serial Prefixes below 1428-Only****Input Amplifier Failures**

If an integrated circuit fails on either the 05345-60003 (A3) or 05345-60004 (A4) Assembly, the other IC in the same channel must also be replaced. Example: A3U2 fails — also replace A4U2; A4U1 fails — also replace A3U1. A matched pair has been established for replacement under part number 05345-80002.

The matched pair is expensive, difficult to obtain and only required on instruments with serial prefixes below 1428. On serial prefixes 1428 and above, only the failed integrated circuit should be replaced. Part numbers for these should be obtained from the Operating and Service Manual.

RH/ka/WO

1/75/-02

HEWLETT  PACKARD

For more information, call your local HP Sales Office or East (201) 265-5000 • Midwest (312) 677-0400 • South (404) 436-6181 • West (213) 877-1281. Or, write: Hewlett-Packard, 1501 Page Mill Road, Palo Alto, California 94304. In Europe, Post Office Box 85, CH-1217 Meyrin 2, Geneva, Switzerland. In Japan, Yokogawa-Hewlett-Packard, 1-59-1, Yoyogi, Shibuya-Ku, Tokyo, 151.

