# S E R V I C E N O T E

SUPERSEDES: NONE

## **Model 54825A Infinium Oscilloscopes**

**Serial Numbers:** See Below

### Improved Side-Handle Mounting Screw Recommended

#### **Duplicate Service Notes:**

54810A-02 Serial Numbers: US36000000 / US38059999 54815A-02 Serial Numbers: US36000000 / US38059999 54820A-02 Serial Numbers: US36000000 / US38059999 54825A-02 Serial Numbers: US36000000 / US38059999 54845A-02 Serial Numbers: US36000000 / US38059999

To Be Performed By: Agilent-Qualified Personal or Customers Parts Required:

P/N	Description	Quantity	
5021-4302	M4x0.7 20mm-lg pan-hd	2	

#### **Situation:**

Recommend replacing the side-handle mounting screw with the new longer screw with patchlock (baked-on plastic) that impedes loosening.

Continued

DATE: July 1998

### ADMINISTRATIVE INFORMATION

SERVICE NOTE CLASSIFICATION:			
MODIFICATION RECOMMENDED			
ACTION CATEGORY:	☐ IMMEDIATELY ☐ ON SPECIFIED FAILURE ■ AGREEABLE TIME	STANDARDS:  LABOR 0.5 Hours	
LOCATION CATEGORY:	<ul><li>■ CUSTOMER INSTALLABLE</li><li>□ ON-SITE</li><li>■ SERVICE CENTER</li></ul>	SERVICE	
AVAILABILITY:	PRODUCT'S SUPPORT LIFE	AGILENT RESPONSIBLE UNTIL: July 2000	
AUTHOR: RK	ENTITY: 0840	ADDITIONAL INFORMATION:	

© 1998 AGILENT TECHNOLOGIES PRINTED IN U.S.A.



#### **Solution / Action:**

- 1) Inspect the side-handle mounting screws. The old screws are silver- colored and should be replaced with the new black-ozide colored screws with patchlock.
- 2) If the screws are of the old type, remove the handle screws using a Torx-15 driver.
- 3) Using the shaft of the Torx driver pry off the handle end-caps. (Place the handle assembly on a flat surface with the screws pointing upward. Place the shaft of the driver between the end caps and the handle plastic. Pry off the end caps.)
- 4) Re-assemble the handle using the new black handle screws.
- 5) Re-attach the handle to the Infinium oscilloscope and torque the screws to 2.4 n/meters (21 in/lbs).