								54	184	-5A-0	7A
S	Е	R	V	Ι	С	Е	N		0	Т	Е
							SUPERSE	DES: {	54845	5A-07	
Agile	nt Mo	odel 54	845A]	Infini	ium O	scilloso	cope				
Serial	Numbe	ers: See E	Below								
Corre	ct Inte	ermittei	nt Loc	kups (Caused	I By the	e Motherbo	ard e	etc		
Duplic	ate Ser	vice Not	es:								
	4-07A					/ US4023					
	A-07A					/ US4023					
	4-07A 4-07A					/ US4023 / US4023					
	A-07A					/ US4023 / US4023					
	A-07A					/ US4023					
∗ This	applies	to units v	with "VI	N# 030	through	032" rea	r-panel labels	only			
To Be	Perfor	med By:	Agilent-	Qualifi	ed Perso	nnel					
Parts I	Require	ed:									
Part N	0.	Qty		Des	cription						
54810-	68780	1	VI	NTAGI	E 33 REO	COVERY	/ KIT				
3500-6	571	1	DE	EOXIDI	ZER CL	EANER					
										Continue	ed
							DATE: July	/ 2000)		

ADMINISTRATIVE INFORMATION

SERVICE NOTE CLASSIFICATION:									
MODIFICATION RECOMMENDED									
ACTION CATEGORY:	IMMEDIATELY ON SPECIFIED FAILURE AGREEABLE TIME	STANDARDS: LABOR 1.0 Hours							
LOCATION CATEGORY:	CUSTOMER INSTALLABLE ON-SITE SERVICE CENTER	SERVICE RETURN USED RETURN INVENTORY: SCRAP PARTS: SCRAP SEE TEXT SEE TEXT							
AVAILABILITY:	PRODUCT'S SUPPORT LIFE	AGILENT RESPONSIBLE UNTIL: November 2001							
AUTHOR: RK	ENTITY: 0840	ADDITIONAL INFORMATION: Bill kit installation to warranty code 02G							

© 2000 AGILENT TECHNOLOGIES
PRINTED IN U.S.A.



Situation:

Infinitium Oscilloscopes, Model 54810A thru 54845A, with rear-panel labels "VIN # 030 thru 032" have experienced intermittent lockup problems due to connector contamination problems. The problems show up as general protection errors, illegal operation errors, blue screen errors, or display screen freezes with no response from the keyboard or mouse. (This only applies to VIN #030 thru 032 units. VIN# 025 and below or VIN# 033 and higher units are not affected.)

Solution:

Using the kit instructions, replace the motherboard and DIMM. Transfer the existing processor and fan to the new board. Install the new power cable and GPIB board. Remaster the existing hard drive using the included LS-120 remaster media. See the following rework procedure:

Rework procedure:

Follow the included installation installations to do the following:

- 1. Replace the A4 pc motherboard with kit supplied motherboard with preinstalled DIMM. Transfer the existing processor from the old board to the new motherboard. See service or installation instructions for the proper motherboard switch settings.
- 2. Reinstall the plug-in boards and install the new GPIB board after cleaning the edge connectors with the DeOxit cleaner. Install the new pc power cable with the better locking connector.
- 3. Reset the BIOS using the included installation instructions or the latest Infiniium service manual available off the web.
- 4. Remaster the hard drive to rev 3.72 or later code using the included LS-120 remastering disks p/n 54810-68778. The CDROM kit p/n 54810-68777 can also be used.
- 5. Reinstall the cabinet, warm up the unit for 30 minutes, run the selfcal and finally verify proper operation by running the selftests.

When finished please replace the rear-panel VIN # 03x label with the new 'VIN # 033' label thus indicating that service note 54810A-07A through 54845A-07A has been installed.