S E R V I C E N O T E

SUPERSEDES: 5517A/18A-1A

HP 5517A/18A Laser Head

Serial Numbers: 0000A00000 / 2532A02311

Repair of Sampler Assembly

To Be Performed By: HP-Qualified Personnel

Parts Required:

HP P/N Description

1990-0768 Liquid Crystal Switch 8160-0530 Elastomeric Connectors

Situation:

It was possible to have electrical connection problems due to mismatched dimensional tolerances that could cause the READY LED to stop blinking in 10 minutes or less after power-up (resulting in a LASr FAIL on the 5508A in the 5528A system), or starts blinking during operation (resulting in a Hd error on the 5508A).

Note

All affected products have been repaired. HP will no longer repair this problem at no charge.

Continued

DATE: July 1995

ADMINISTRATIVE INFORMATION

| SERVICE NOTE CLASSIFICATION: | | |
|------------------------------|---|---|
| MODIFICATION RECOMMENDED | | |
| ACTION CATEGORY: | ☐ IMMEDIATELY ■ ON SPECIFIED FAILURE ☐ AGREEABLE TIME | STANDARDS: LABOR 0.0 Hours |
| LOCATION CATEGORY: | ☐ CUSTOMER INSTALLABLE☐ ON-SITE☐ HP LOCATION | SERVICE RETURN USED RETURN PARTS: SCRAP SEE TEXT |
| AVAILABILITY: | PRODUCTS SUPPORT LIFE | HP RESPONSIBLE UNTIL: September 1989 |
| AUTHOR: MD | ENTITY: 5500 | ADDITIONAL INFORMATION: Products have been fixed. |

© 1995 HEWLETT-PACKARD COMPANY PRINTED IN U.S.A.



Solution/Action:

Sub-assemblies of the sampler were redesigned and the color of the elastomeric connector changed to gray from pink or black. Old Sampler Assemblies identified by pink or black elastomeric connectors, were repaired by replacing the Liquid Crystal Switch and the Elastomeric Connectors with new ones.

Note

See superseded Service Note 5517A/18A-1A for detail replacement instructions.