SERVICE NOTE

SUPERSEDES:

6259B-3 6268B-2 6260B-2

HP MODELS 6259B, 6260B, 6261B, 6268B, 6269B LVR POWER SUPPLIES Serial Numbers 2035A01215 and below (6259B) Serial Numbers 2031A02495 and below (6260B) Serial Numbers 2034A01590 and below (6261B) Serial Numbers 2034A04150 and below (6268B) Serial Numbers 2033A05820 and below (6269B) IMPROVED RELIABILITY CHANGES

- 1. Change fan B1, tubeaxial from sleeve bearing type (P/N 3160-0056) to ball bearing type (P/N 3160-0369).
- 2. Change fan B2 (6269B only from) P/N 3160-0056 to new P/N 3160-0369. The new fans are expected to last longer and have greater reliability at elevated temperatures.

NOTE: These fans should be replaced for all warranty repairs. For non-warranty repairs, these changes should be recommended to the customer.

3. In the event of a Tunnel Assy fan failure (B1), the four 8½ inch plastic standoffs (P/N 0380-0901) on the heat sink assembly should **always** be replaced. The increased temperature may have caused the material to become brittle and eventually break. This could short out the heat sinks and damage the power supply. Visual inspection will not determine if the standoffs have become brittle. For ease of installation, rods should be replaced one at a time.

JY/jm/WO

12/80-21



FOR MORE INFORMATION, CALL YOUR LOCAL HP SALES OR SERVICE OFFICE or East (201) 265-5000
Midwest (312) 255-9800
South (404) 955-1500
West (213) 970-7500 or (415) 968-9200; OR WRITE, Hewlett-Packard, 1501 Page Mill Road, Palo Alto, California 94304.
IN EUROPE, CALL YOUR LOCAL HP SALES or SERVICE OFFICE OR WRITE, Hewlett-Packard S.A., 7, rue du Bois-du-Lan, P.O. Box,
CH-1217 MEYRIN 2 - Geneva, Switzerland. IN JAPAN, Yokogawa-Hewlett-Packard Ltd., 9-1, Takakura-cho, Hachioji-shi, Tokyo, Japan 192.