S E R V I C E N O T E

SUPERSEDES: NONE

6574A 2KW General Purpose Power Supply

Serial Number: See below

Intermittent Phone Cables

Duplicate Service Notes:

6571A-03	US36520140 / US36520154
6572A-03	US36350146 / US36350165
6573A-03	US36330256 / US36330326
6574A-04	US36340286 / US36340386
6575A-05	US36340146 / US36340172
6671A-05	US36400212 / US36400267
6672A-05	US36390401 / US36390461
6673A-05	US36380376 / US36380605
6674A-06	US36370827 / US36371132
6675A-07	US36370336 / US36370431

To Be Performed By: Agilent-Qualified Personnel

Parts Required:

5080-2167 (W4; A2 bd. to bd. A5) 5080-2168 (W5; A2 bd. to bd. A1)

Continued

DATE: August 1999

ADMINISTRATIVE INFORMATION

SERVICE NOTE CLASSIFICATION:			
MODIFICATION RECOMMENDED			
ACTION CATEGORY:	☐ IMMEDIATELY ☐ ON SPECIFIED FAILURE ☐ AGREEABLE TIME	STANDARDS: LABOR 0.5 Hours	
LOCATION CATEGORY:	☐ CUSTOMER INSTALLABLE ☐ ON-SITE ☐ SERVICE CENTER	SERVICE □ RETURN USED □ RETURN PARTS: ■ SCRAP □ SEE TEXT □ SEE TEXT	
AVAILABILITY:	PRODUCT'S SUPPORT LIFE	AGILENT RESPONSIBLE UNTIL: End of Product Support Life	
AUTHOR: BM	ENTITY: 2100	ADDITIONAL INFORMATION:	

© 1999 AGILENT TECHNOLOGIES PRINTED IN U.S.A.



Page 2 Service Note 6574A-04

Situation:

The 2 phone style cables might have been improperly crimped causing intermittent connections on the cables. Could cause "Secondary Down" or "Serial Down" message.

Solution / Action:

Units returned for any reason in the specified serial number range exhibiting "Secondary" or "Serial Down" messages or intermittent communication problems. Replace the gray phone style cables.