# 66102A-07A

# S E R V I C E N O T E

Supersedes: 66102A-07

# 66102A DC Power Supply

Serial Numbers: All

The instrument will not communicate or will not complete self test.

**Parts Required:** 

P/N	Description	
1200-0567	SOCKET-IC-DIP 28-CONT DIP DIP-SLDR	1
5080-2529	ROM-PRGMD	1
6610X-61022	PCA-TSTD,PWRMESH	1

#### SPECIAL REPAIR NOTE! (Circuit Reference "U2").

The ROM-PRGMD <u>p/n 5080-2529</u> should only be replaced if it is cracked or broken or the pins are intermittent.

The SOCKET-IC-DIP 28-CONT DIP DIP-SLDR p/n <u>1200-0567</u> should only be replaced if it is cracked or broken or the pins are intermittent.

The PCA-TSTD,PWRMESH p/n <u>66101-61022</u> should only be replaced if the traces on the printed circuit board are damaged during the removal of the socket.

It is very unlikely that the PCA-Tested assembly p/n  $\underline{66101-61022}$  or the socket p/n  $\underline{1200-0567}$  will need to be replaced.

### ADMINISTRATIVE INFORMATION

SERVICE NOTE CLASSIFICATION:			
MODIFICATION AVAILABLE			
ACTION CATEGORY::	AGREEABLE TIME	[[]] PERFORMANCE ENHANCEMENT X SERVICE / RELIABILITY ENHANCEMENT	
LOCATION CATEGORY:	X CUSTOMER INSTALLABLE [[]] ON-SITE X SERVICE CENTER X CHANNEL PARTNERS	AVAILABILITY: Always	
AUTHOR: CP		PRODUCT LINE: SP	
ADDITIONAL INFORMATION: If care is taken "U2" can be inspected & reinstalled with out taking the entire instrument apart 1/4 hr if unit is not taken apart, 1hr complete repair			

© AGILENT TECHNOLOGIES, INC. 2008 PRINTED IN U.S.A.



November 3, 2008

Rev. 15 Page 1 of 3

Page 2 of 3 66102A-07A

#### **Situation:**

The Programmed ROM P/N 5080-2529 (Circuit Reference "U2") See <u>Figure</u> 1.below for the location of "U2". The Programmed ROM Shows "U2" can be inspected with out taking the entire instrument apart see figure 2 below. Inspect the ROM "U2" as described in <u>Diagrams "A & B"</u> below.

When the ROM "U2" is not inserted correctly See <u>Diagram "A"</u> for details, the instrument may exhibit the following faults:

These faults could also occur if the ROM or the socket is intermittent due to dirty or contaminated pins.

- 1. The instrument will not turn on
- 2. All of the segments on the Front Panel display are not light.
- 3. The instrument will fail self test or will not boot-up.
- 4. The instrument will not communicate & can not be calibrated.

#### **Solution/Action:**

The ROM "U2" should be removed from the socket. (See Figure 1). The socket and the ROM should be inspected for contamination or other defects. The ROM is a ceramic part and can be damaged or broken if too much force is applied when reinstalled. <u>Diagram "B"</u> shows the ROM "U2" inserted correctly.

#### **NOTE**

The ROM "U2" is a static sensitive part, when removing and reinstalling the ROM use procedures that will eliminate ESD (Electro Static Discharge) which may damage the ROM.

Note If the ROM "U2" is replaced Initialization is may not be required.

**FIGURE 1** Is the Tested PCA P/N 66101-61022 note (Location of Circuit Reference "U2") **FIGURE 2** Is the bottom of a 6610XA module "U2" is located directly behind the fuse shown.



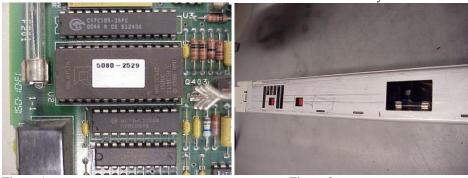


Figure 1 Figure 2

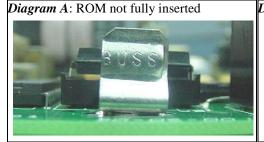

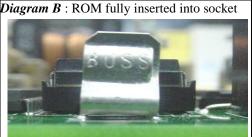

#### Special Note

The following Service Notes described below are other models that may have the same problem as described above.

66101A-08A 66103A-07A 66105A-08A 66102A-07A 66104A-08A 66106A-07A

Page 3 of 3 66102A-07A

## **Related Service Notes**

The following Service Notes may have the same problem "The instrument will not communicate or will not complete self test."

The parts described are different then described in this service note and should be inspected as recommended in the related Service notes.

66101A-09A, 66102A-08A, 66103A-08A, 66104A-09A, 66105A-09A, 66106A-08A,

### "SPO" (Support Parts Organization)

All SPO the inventory of the SOCKET-IC-DIP 28-CONT DIP DIP-SLDR P/N 1200-1274 & the PCA-TSTD PWRMESH P/N 6610X-61022 has been inspected for the described defect.