S E R V I C E N O T E

SUPERSEDES: NONE

66104A Modular DC Power Supply

Serial Numbers: See below

Turnoff Voltage Overshoot

Duplicate Service Notes:

66101A-06 Serial Numbers: 0000A00000 / 3444A03901 66102A-05 Serial Numbers: 0000A00000 / 9999A99999 66103A-05 Serial Numbers: 0000A00000 / 9999A99999 66104A-06 Serial Numbers: 0000A00000 / 3445A02436 66105A-06 Serial Numbers: 0000A00000 / 3421A01031 66106A-05 Serial Numbers: 0000A00000 / 9999A99999

To Be Performed By: Agilent-Qualified Personnel

Parts Required:

P/N Description Quantity
0180-4273 Capacitor 1

Continued

DATE: December 1997

ADMINISTRATIVE INFORMATION

SERVICE NOTE CLASSIFICATION:		
MODIFICATION RECOMMENDED		
ACTION CATEGORY:	☐ IMMEDIATELY■ ON SPECIFIED FAILURE☐ AGREEABLE TIME	STANDARDS: LABOR 1.0 Hours
LOCATION CATEGORY:	☐ CUSTOMER INSTALLABLE☐ ON-SITE☐ SERVICE CENTER	SERVICE RETURN USED RETURN PARTS: SCRAP SEE TEXT
AVAILABILITY:	PRODUCT'S SUPPORT LIFE	AGILENT RESPONSIBLE UNTIL: December 1999
AUTHOR: GS	ENTITY: 2100	ADDITIONAL INFORMATION:

© 1997 AGILENT TECHNOLOGIES PRINTED IN U.S.A.



Page 2 Service Note 66104A-06

Situation:

If the unit is turned-off while the output is enabled, the voltage is set low, at high line, and the overvoltage protection is set high, there may be a voltage overshoot with a duration of around 50 ms and peak voltage about 25 percent greater than full scale voltage.

Solution / Action:

Replace capacitor C402 with a 1000 uf capacitor (P/N 0180-4273). Note: make sure the capacitor polarities match those on the circuit board.