# S E R V I C E N O T E

SUPERSEDES: 6644A-03

# 6644A 200W General Purpose Power Supply

Serial Number: See below

#### **Intermittent Phone Cables**

#### **Duplicate Service Notes:**

6541A-02A	US36360146 / US36360165
6542A-02A	US36360286 / US36360315
6543A-02A	US36340266 / US36340336
6544A-02A	US36390176 / US36390211
6545A-03A	US36340126 / US36340141
6641A-03A	US36410246 / US36410290
6642A-03A	US36400586 / US36400776
6643A-03A	US36400711 / US36400830
6644A-03A	US36410441 / US36410576
6645A-04A	US36390351 / US36390451

**To Be Performed By:** Agilent-Qualified Personnel

#### **Parts Required:**

06652-80011 (W10, p/n 06652-80011) 06652-80010 (W9, p/n 06652-80010)

Continued

DATE: February 2001

### ADMINISTRATIVE INFORMATION

SERVICE NOTE CLASSIFICATION:			
MODIFICATION RECOMMENDED			
ACTION CATEGORY:	<ul><li>☐ IMMEDIATELY</li><li>☐ ON SPECIFIED FAILURE</li><li>☐ AGREEABLE TIME</li></ul>	STANDARDS:  LABOR 0.5 Hours	
LOCATION CATEGORY:	☐ CUSTOMER INSTALLABLE☐ ON-SITE☐ SERVICE CENTER	SERVICE ☐ RETURN USED ☐ RETURN PARTS: ☐ SCRAP☐ SEE TEXT ☐ SEE TEXT	
AVAILABILITY:	PRODUCT'S SUPPORT LIFE	AGILENT RESPONSIBLE UNTIL: End of Product Support Life	
AUTHOR: BM	ENTITY: 2100	ADDITIONAL INFORMATION: This is a multi Model No. Service Note	

© 2001 AGILENT TECHNOLOGIES PRINTED IN U.S.A.



#### **Situation:**

The 2 phone style cables might have been improperly crimped causing intermittent connections on the cables. Could cause "Secondary Down" or "Serial Down" message.

## **Solution / Action:**

Units returned for any reason in the specified serial number range exhibiting "Secondary" or "Serial Down" messages or intermittent communication problems. Replace the gray phone style cables.