									66	55A-	-07
S	Е	R	V	Ι	С	Е		Ν	0	Т	Е
							SUPER	SEDE	S: NON	E	
6655	5A #J1	1 500\	W Gene	eral P	urpose	Powe	r Suppl	y OP'	TION J	J 11	
Serial Numbers:											
US3639A00480 / US3639A00499											
US3639A00591 / US3639A00628 US2620A00621 / US2620A00625											
US3639A00631 / US3639A00635 US3639A00646 / US3639A00653											
Capacitor Change to improve performance											
Cup		211a11g			periorii	lunive					
To Be Performed By: Agilent-Qualified Personnel											
Parts Required:											
Agile	ent P/N	De	scription		Quar	ntity					
0160-	-4813	180 j	pF cap		1						
Situa	tion:										
The power supply goes into UNR status when it is turned on with the front panel key											
OUTPUT ON/OFF in CV mode. In this mode, a voltage loop causes the output to increase rapidly. This action then causes the SCR to fire.											
Solution / Action:											
Chan	ge the caj	pacitor (C1000) a	cross R	R173 to 18	0 pF (P/	'N 0160-48	313).			
							DATE:	Februa	ary 2000		

ADMINISTRATIVE INFORMATION

SERVICE NOTE CLASSIFICATION: MODIFICATION RECOMMENDED								
ACTION CATEGORY:	 IMMEDIATELY ON SPECIFIED FAILURE AGREEABLE TIME 	STANDARDS: LABOR 2.0 Hours						
LOCATION CATEGORY:	 CUSTOMER INSTALLABLE ON-SITE SERVICE CENTER 	SERVICE □ RETURN USED □ RETURN INVENTORY: ■ SCRAP PARTS: ■ SCRAP □ SEE TEXT □ SEE TEXT □ SEE TEXT						
AVAILABILITY:	PRODUCT'S SUPPORT LIFE	AGILENT RESPONSIBLE UNTIL: February 2002						
AUTHOR: FP	ENTITY: 2100	ADDITIONAL INFORMATION:						

© 2000 AGILENT TECHNOLOGIES PRINTED IN U.S.A.



Agilent Technologies