
6674A-05

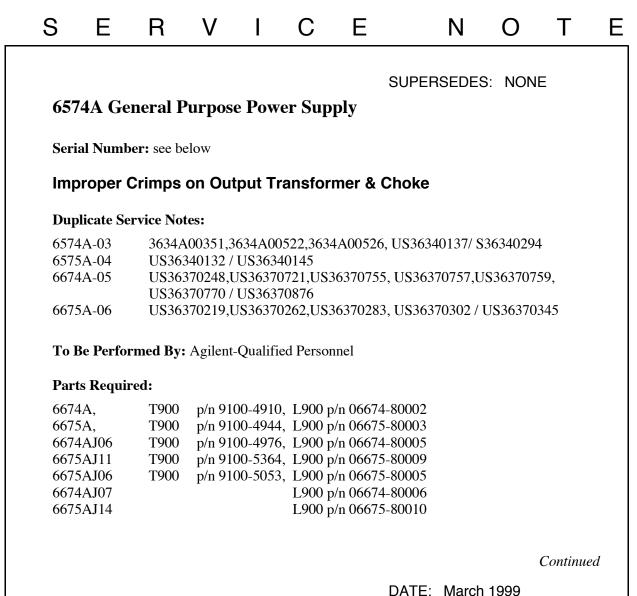

ADMINISTRATIVE INFORMATION

SERVICE NOTE CLASSIFICATION: MODIFICATION RECOMMENDED		
ACTION CATEGORY:	■ IMMEDIATELY □ ON SPECIFIED FAILURE □ AGREEABLE TIME	STANDARDS: LABOR 2.0 Hours
LOCATION CATEGORY:	□ CUSTOMER INSTALLABLE □ ON-SITE ■ SERVICE CENTER	SERVICE RETURN USED RETURN INVENTORY: SCRAP PARTS: SCRAP SEE TEXT SEE TEXT
AVAILABILITY:	PRODUCT'S SUPPORT LIFE	AGILENT RESPONSIBLE UNTIL: End of Product Support Life
AUTHOR: BM	ENTITY: 2100	ADDITIONAL INFORMATION: This is a multi Model No. Service Note

© 1999 AGILENT TECHNOLOGIES PRINTED IN U.S.A.



Situation:

Units with Output Transformer, T900 & Choke L900 with date codes 90121 and 90321 could have been improperly crimped. The date codes are printed in white on top of the devices. This could result in intermittent output, arcing or buzzing Sounds, unit resets itself, high ripple.

Solution / Action:

Units returned for any reason with the specified serial numbers should have their date codes checked, and replace the transformer-T900 and choke-L900 if they have the affected date codes (90121;90321).