81150A-01 S E R V I C E N O T E

Supersedes: NONE

81150A Pulse Function Arbitrary Noise Generator

Serial Numbers: DE47C00101 / DE47C00189

Starting in August 2007 *wrong* SMT fuses were loaded on PCA of the 81150A (shipment release was in January 2008).

Parts Required:

P/N Description Qty.

2110-1112 FUSE 1.5A 125.0V 3

ADMINISTRATIVE INFORMATION

SERVICE NOTE CLASSIFICATION:					
MODIFICATION RECOMMENDED					
ACTION CATEGORY:	[[]] ON SPECIFIED FAILURE XX AGREEABLE TIME	STANDARDS LABOR: 0.0 Hours			
LOCATION CATEGORY:	[[]] CUSTOMER INSTALLABLE [[]] ON-SITE XX SERVICE CENTER [[]] CHANNEL PARTNER	SERVICE XX RETURN INVENTORY: [[]] SCRAP [[]] SEE TEXT	USED [[]] RETURN PARTS: XX SCRAP [[]] SEE TEXT		
AVAILABILITY:	PRODUCT'S SUPPORT LIFE	NO CHARGE AVAILABLE UNTIL: 30-Sep-2013			
AUTHOR: HK		PRODUCT LINE: PL24			
ADDITIONAL INFORMATION:					

© AGILENT TECHNOLOGIES, INC. 2008 PRINTED IN U.S.A.



Page 1 of 3

September 17, 2008

Rev. 15

Page 2 of 3 81150A-01

Situation:

Starting in August 2007 wrong SMT fuses were loaded on PCAs of the 81150A product.

SMT fuse: Agilent part number: 2110-1112

Item Description: FUSE 1.5A 125.0V NON-TIME-DELAY 0.0630OHM

0.0061X0.00269X0.00269MM SMT

The wrong SMT fuse which was loaded had a current limit of 15A.

The problem is fixed for all shipments since 01-April-2008.

The affected PCAs and Reference Designators and serial numbers are:

Product	PCA	Reference Designators	Serial numbers
81150A	81150-66401	F202, F207, F301	DE47C00101 DE47C00189
	81150-66402		

Solution/Action:

Replace all wrong SMTs fuses on the listed PCA when products come to service center for any kind of service order when the product serial number is in the defined range.

Page 3 of 3 81150A-01

Location of the fuses on the PCAs

81150-66401 / 81150-66402

