S	Е	R	V	Ι	С	Е	Ν	0	Т	Ε
							SUPERSEDE	ES: 816	6A-01	
816	66A Lig	ghtwav	e Mult	ichan	nel Sy	stem				
Seri	als: D	E396001	001 / DE	396003	22					
Rec	comme	nded M	IOV ren	noval	in 8166	SA now	er supply			
Tol	Re Perfo	rmed Rv	• A oilent-	Qualifi	ed Person	nnel	ci suppiy			
101		rincu Dy	•7 Ignoin	Quann	cu i cisoi					
Part	ts Requi	red:None	e							
Situ	ation:									
acco haza Agil havi	ompanied ard involv ent/OCN ng seen a	l by a loue ved. Beca ID decide a failure s	d noise, s use custo ed to offe to far.	moke a omers m r a full	nd possil night pero modifica	ole spray ceive sucl tion on a	of small partical h failures as seri ll related produc	s. There ous quali ts, despit	is no safety ty problem e of not	7 2
Solu	tion / A	ction:								
•	The Mo	OV shall	be remov	ed with	out repla	acement (component is re	dundant)		
•	Disasse	emble the	8166A to	o get ac	cess to th	ne power	supply			
•	Remov	e the pow	ver supply	y from t	he chass	is				
•	Cut off	the MOV	/ by use o	of wire	cutting p	liers				
•	Re-inst	all the po	wer supp	ly						
•	Re-asse	emble the	8166A							
•	Perform	n a functi	onal test							
									Continue	ed.
							DATE: Marc	h 2001		

ADMINISTRATIVE INFORMATION

SERVICE NOTE CLA	SSIFICATION: MODIFICATION I	RECOMMENDED
ACTION CATEGORY:	IMMEDIATELY ☐ ON SPECIFIED FAILURE ☐ AGREEABLE TIME	STANDARDS: LABOR 0.5 Hours
LOCATION CATEGORY:	CUSTOMER INSTALLABLE	SERVICE RETURN USED RETURN INVENTORY: SCRAP SCRAP SCRAP SEE TEXT SEE TEXT SEE TEXT
AVAILABILITY:	PRODUCT'S SUPPORT LIFE	AGILENT RESPONSIBLE UNTIL: November 2002
AUTHOR: VE	ENTITY: OCMD	ADDITIONAL INFORMATION:

© 2000 AGILENT TECHNOLOGIES
PRINTED IN U.S.A.



8166A-01A

Disassembly and Assembly

This document contains the procedure to remove the redundant metal oxide varistor (MOV) on the 8166A power supply. Assembling the instrument is the reverse of this procedure.

WARNING

Static electricity can damage a board, the following precautions must be taken when working inside the product. Handle the boards by the edges When handling the board always wear a grounding wrist strap. **Disconnect the instrument from power before opening !**

Required Tools:

TORX 10 Pozidrive 2 Wire cutting pliers

1. Open the instrument

• Unscrew the cover fixed with 5 ea M3.5x6, marked by



2. Remove the I/O-CPU Assy

- Disconnect the 2 flat cables leading to the display.
- Disconnect cable of Fan Assy, small, from CPU board assy.
- Unfasten 3 ea screws 0515-0372, marked by

Continued



• Unfasten I/O-CPU Board Assy by unscrewing 4 ea screws, marked by

holding the board panel on the rear to the chassis

• Remove I/O-CPU Board Assy from chassis



• When re-assembling:

Make sure the I/O board fits well into the connector on the back plane.

You can hold the back plane with a tool to not to let it move away



3. Remove the the Fan Assy, small

- Disconnect power supply cable (twisted, 2 wires black and red) from backplane
- Remove foam part, labeled 08166-44504 -





• Remove fan assy, small, and both foam parts, labled 08166-44504 and -44503



4. Remove the Power Supply Assy

- Remove foam parts, labeled 08166-44505 and -44506 above the power supply
- Disconnect power cables from power inlet
- Possibly remove Cable Assy Ground (green/yellow)



- Disconnect multiple single wire assy, colored cables, with white connector from back plane (mother board)
- Disconnect multiple single wire cable assy , black and white, with black connector from back plane (mother board)

Attention: When re-assembling check if all 4 wire cable assies and 1 wire cable are fixed well on the Power Supply Assy



- Unfasten 4 ea interlock screws 0515-0390 on the left of the chassis
- Remove Power Supply Assy

5. Cut off the MOV

The MOV is a component located on the rear of the power supply right between a big black capacitor (possibly with a label "PFC375-S150" on it) and the input power line cables. It's covered by a - mostly white - shrinking tube. Use wire cutting pliers to cut it off. See Figure1 and Figure 2 on next page.

6. Reassemble and Functional Test

After modification of the power supply, reassemble the 8166A. This is reverse to the procedure described in item 1 to 4. Make sure, all cables are connected properly.

Finally, do a functional test: Switch on the 8166A and wait until it has booted. Indication for proper work:

- 1. booting without failure
- 2. all slots are displayed on the screen
- 3. Mainframe is recognized: Press [Config] Using the RPG, select "About Mainframe", press [Enter] A window pops up and displays the manufacturer, model number, serial number and firmware revision

Continued

Photos showing a power supply of 8164A. That of the 8166A looks equal but with label "PFC375-S150" on the capacitor



Figure 1: MOV shown while beeing removed by use of wire cutting pliers



Figure 2: rear view of the power supply, MOV (VR1) has been removed