S E R V I C E N O T E

SUPERSEDES: None

83215A RF Interface

Serial Numbers: JP1KA00105, 106, 108, 120, 125, 126, 128, 141, 159, 161

Modification corrects RX sensitivity measurement value

To Be Performed By: Agilent-Qualified Personnel

Parts Required:

P/N	Qty.	Description
83215-61022	1	A2 Module (for non-opt. 006)
83215-61021	1	A2 Module (for opt. 006)
83215-61023	1	A3 Module

Situation:

Old 83215A has noisy A2/A3 modules. It causes about up to 2 dB worse RX sensitivity measurement results than 83215A with newly designed A2/A3.

Solution/Action:

Replacing A2/A3 improves the RX sensitivity measurement performance. All adjustments and performance tests should be performed after the modification.

Note

For instrument with Option 002, additional modifications are required. Contact the factory for more information.

DATE: October 1995

ADMINISTRATIVE INFORMATION

SERVICE NOTE CLASSIFICATION:				
MODIFICATION RECOMMENDED				
ACTION CATEGORY:	☐ IMMEDIATELY☐ ON SPECIFIED FAILURE☐ AGREEABLE TIME	STANDARDS: Labor 5.0 Hours		
LOCATION CATEGORY:	☐ CUSTOMER INSTALLABLE☐ ON-SITE☐ SERVICE CENTER	SERVICE		
AVAILABILITY:	PRODUCT'S SUPPORT LIFE	AGILENT RESPONSIBLE UNTIL:		
AUTHOR: YO	ENTITY: 3355	ADDITIONAL INFORMATION:		

© 1995 AGILENT TECHNOLOGIES PRINTED IN U.S.A.

