S E R V I C E N O T E

SUPERSEDES: NONE

83236B PCS Interface K2 Coaxial Switch

Serial Numbers: 3711J05024, 05025, 05029, 05031, 05034, 05035, 05042, 05043,

05044, 05045, 05046, 05047, 05051

Intermittent contact of the Coaxial Switch

To Be Performed By: Agilent-Qualified Personnel

Parts Required:

P/N Description Quantity
83215-60032 Coaxial Switch 1

Situation:

It has been found that instruments with the given serial number have a unreliable coaxial switch, due to insufficient clinching process of the solder terminal of it. K2 switch may not work intermittently.

Solution / Action:

Replace the K2 Coaxial Switch according to the replacement procedure on the page 4-10 of the 83236A/B ALR manual. Perform the performance test. If it fails, perform the calibration and adjustment.

DATE: September 1999

ADMINISTRATIVE INFORMATION

SERVICE NOTE CLASSIFICATION:		
MODIFICATION RECOMMENDED		
ACTION CATEGORY:	☐ IMMEDIATELY ☐ ON SPECIFIED FAILURE ■ AGREEABLE TIME	STANDARDS: LABOR 1.5 Hours
LOCATION CATEGORY:	☐ CUSTOMER INSTALLABLE☐ ON-SITE☐ SERVICE CENTER	SERVICE RETURN USED RETURN PARTS: SCRAP SEE TEXT
AVAILABILITY:	PRODUCT'S SUPPORT LIFE	AGILENT RESPONSIBLE UNTIL:
AUTHOR: SA	ENTITY: 3355	ADDITIONAL INFORMATION:

© 1999 AGILENT TECHNOLOGIES PRINTED IN U.S.A.

