

S E R V I C E N O T E

SUPERSEDES: 85060A-01

85060A Electronic Calibration Module**Serial Numbers:** See below**To use with 85097A Ecal PC interface, older Ecal modules must be modified****Duplicate Service Notes:**

85060A-01A Electronic Calibration Module (Serial Numbers: 100 / 800)

85062A-01A Electronic Calibration Module (Serial Numbers: 100 / 800)

85064A-01A Electronic Calibration Module (Serial Numbers: 100 / 800)

Situation:

The 85097A Electronic Calibration PC Interface Module requires all Electronic Calibration Modules to have a jumper installed internal to the modules which allows the PC Interface Module to determine if the modules are connected to it. Older Electronic Calibration Modules do not have this jumper, therefore the PC Interface Module will not be able to detect them.

Solution / Action:

All modules with a serial number greater than 800 already have this jumper installed in them. Modules with serial numbers less than 800 did not ship with the jumper installed, but the jumper should have been installed if the module was factory re-certified on or after 2/25/98. If the jumper is present, a voltmeter will be able to detect continuity between pin numbers 5 and 18 of the D-Sub connector on the module housing. If the module does not have the

DATE: May 1999

ADMINISTRATIVE INFORMATION

SERVICE NOTE CLASSIFICATION:			
MODIFICATION RECOMMENDED			
ACTION CATEGORY:	☐ IMMEDIATELY ☒ ON SPECIFIED FAILURE ☒ AGREEABLE TIME	STANDARDS: LABOR 1.0 Hours	
LOCATION CATEGORY:	☐ CUSTOMER INSTALLABLE ☐ ON-SITE ☒ SERVICE CENTER	SERVICE INVENTORY: ☐ RETURN ☐ SCRAP ☒ SEE TEXT	USED PARTS: ☐ RETURN ☒ SCRAP ☐ SEE TEXT
AVAILABILITY:	PRODUCT'S SUPPORT LIFE		
AUTHOR: BH		AGILENT RESPONSIBLE UNTIL: May 2001	
ENTITY: 5320		ADDITIONAL INFORMATION:	

jumper, the module can be sent to the factory repair coordinator to have the jumper installed under warranty. Refer to the address information below for shipment.

Agilent Technologies
Factory Repair Coordinator (Mail Stop 2L-S)
1400 Fountaingrove Parkway
Santa Rosa, California 95403
Attn: No charge, jumper installation