8563E-17

S	Ε	R	V	I	С	Ε	Ν	0	Т	Ε
							SUPERSEDES	S: NON	E	
856	63E Po	rtable <b>S</b>	Spectru	ım Aı	nalyzer					
Serial Numbers: See Below										
Red	ducing	300 kH	z Sideb	ands						
Dup	licate Se	ervice No	tes:							

8560E-17 Serials: 3632A02407 / 3743A03259 8562E-05 Serials: 0000A00000 / 3743A00561 8563E-17 Serials: 3645A06020 / 3743A07920 8564E-12 Serials: 3641A00611 / 3743A01005

8565E-12 Serials: 3641A00533 / 3743A00793

To Be Performed By: Agilent-Qualified Personnel

## **Parts Required:**

P/N	Description	Quantity
08564-60026	A6A2 Regulator Ay.	1 ea.

Continued

DATE: December 1997

## ADMINISTRATIVE INFORMATION

SERVICE NOTE CLASSIFICATION:							
MODIFICATION RECOMMENDED							
ACTION CATEGORY:	<ul> <li>IMMEDIATELY</li> <li>ON SPECIFIED FAILURE</li> <li>AGREEABLE TIME</li> </ul>	STANDARDS: LABOR 0.5 Hours					
LOCATION CATEGORY:	CUSTOMER INSTALLABLE	SERVICE     RETURN     USED     RETURN       INVENTORY:     SCRAP     PARTS:     SCRAP       SEE TEXT     SEE TEXT     SEE TEXT					
AVAILABILITY:	PRODUCT'S SUPPORT LIFE	AGILENT RESPONSIBLE UNTIL: December 1999					
AUTHOR: GPB	ENTITY: 5320	ADDITIONAL INFORMATION:					

© 1997 AGILENT TECHNOLOGIES PRINTED IN U.S.A.



## Situation:

Some instruments may fail the Spurious Response spec at 300 kHz offset from a signal. This can be the result of inadequate filtering on the -5 Volt bias supply to the A8 Low Band Mixer.

## **Solution / Action:**

Replace the older A6A2 Regulator assembly 08564-60009 with part number 08564-60026 or later. Later regulator assemblies haved added filtering on the -5 volt supply. This modification can also improve performance of instruments which already meet the Spurious Response specifications.