

S E R V I C E N O T E

SUPERSEDES: None

86793A Agile Microwave Upconverter

Serial Numbers: 0000A00000 / 9999A99999

Incorrect Reference Designators reported back during Diagnostics Test 3XX

Duplicate Service Notes: E2505A-01

Parts Required: None

Situation:

When running diagnostics tests with Firmware Version 1.43 and below, test 3XX will return incorrect reference designators for checking.

Solution/Action:

Use the attached table to cross reference to the correct reference designator until the next version of Firmware is released.

Continued

DATE: 21 April 1993

ADMINISTRATIVE INFORMATION

SERVICE NOTE CLASSIFICATION:		
INFORMATION ONLY		
AUTHOR:	ENTITY:	ADDITIONAL INFORMATION:
DGS	0400	

What Firmware reports:	What should be checked:
-60101 Assembly	A6A1
-60102 Assembly	A6A2
A5A3	A5U1
A5A1	A5U2
A5A2	A5U3
A5A4	A5U6
A5FL1	A5FL3
A5FL3	A5FL5
A5FL4	A5FL6
A5FL5	A5FL8
A5FL6	A5FL9
A5FL7	A5FL10
A5FL8	A5FL11
A3U1	A3U3
A3U3	A3U2
Check RFin (XXXHz-10 dBm)	Check RFin (XXXHz 0 dBm)

Table 1. Reference Designator Cross Reference