## DSO90604A-06A

# S E R V I C E N O T E

Supersedes: DSO90604A-06

DSO90604A Infiniium High Performance Oscilloscope: 6GHz

Serial Numbers: MY00000000 up to MY49470100 and SG00000000 up to SG49470100

ICCY is characterized by the intermittent failure of Windows to recognize the Infiniium acquisition hardware on the PCle bus after a Windows boot process, resulting in the "Infiniium cannot communicate with the acquisition hardware. Please contact Agilent support." error message during the initialization of the Infiniium oscilloscope application.

**Parts Required:** 

P/N Description Qty.

54913-68719 DSO/DSA90000 series repair kit for M880 motherboard 1

### ADMINISTRATIVE INFORMATION

SERVICE NOTE CLASSIFICATION:				
MODIFICATION RECOMMENDED				
ACTION X ON SPECIFIED FAILURE CATEGORY: [[]] AGREEABLE TIME	STANDARDS  LABOR: 1.0 Hours			
LOCATION [[]] CUSTOMER INSTALLABLE CATEGORY: [[]] ON-SITE (active On-site contract required) X SERVICE CENTER [[]] CHANNEL PARTNER	SERVICE X RETURN INVENTORY: [[]] SCRAP [[]] SEE TEXT  USED [[]] RETURN PARTS: X SCRAP [[]] SEE TEXT			
AVAILABILITY: PRODUCT'S SUPPORT LIFE	NO CHARGE AVAILABLE UNTIL: (EOS.)			
[[]] Calibration Required XCalibration NOT Required	PRODUCT LINE: 1A AUTHOR: MR			
ADDITIONAL INFORMATION:CHARGE 54913-68719 PARTS AND 1 HOUR LABOR TO FACTORY WARRANTY  Calibration is not required and will not be covered by factory warranty.				

© AGILENT TECHNOLOGIES, INC. 2013 PRINTED IN U.S.A.



Page 1 of 2

October 1, 2013

Rev. 21

Page 2 of 2 DSO90604A-06A

On specified failure for DSO/DSA90000 series oscilloscope displays the following error intermittently or consistently on boot up, "Infiniium cannot communicate with the acquisition hardware. Please contact Agilent support." error message during the initialization of the Infiniium oscilloscope application.

#### **Solution/Action:**

The repair is to replace the M880 motherboard and SATA cables, using the M880 Motherboard Replacement Kit, part number 54913-68719.

The easiest way to recognize the M880 motherboard from the M890 motherboard is the White DVI connector on the motherboard port panel. If the motherboard has this white DVI connector it is a M890 motherboard.

M890 Motherboard port panel.



If there already is a M890 motherboard installed then this is NOT covered per this service note. If the Serial # is > than the listed range then troubleshoot and handle as normal processes and procedures. It is not covered by this service note.

Calibration is not required and will not be covered by factory warranty.

Charge the cost of the replacement part Motherboard Kit (54913-68719) and labor to replace the part to factory warranty. The Total Labor charges not to exceed 1.0 Hour. Follow Service manual replacement process.

### **Revision History:**

Revision	Date	Author	Reason For Change
Number			
1.0	10/16/2012	Mark Rowley	Original release
2.0	10/1/2013	Mark Rowley	Added Factory Warranty charging dialog, and changed
			template to MR