E3641A-02

# SERVICE NOTE

Supersedes: NONE

## E3641A DC Power Supply

Serial Numbers: MY40001893 / MY40002139

Difficulty to adjust the knob control on front panel due to encoder issue.

To Be Performed By: Agilent-Qualified Personnel

Parts Required:

P/N Description Qty.

0960-2545 Rotary encoder insulated shaft 1

### ADMINISTRATIVE INFORMATION

SERVICE NOTE CLASSIFICATION:			
MODIFICATION RECOMMENDED			
ACTION	[[]] IMMEDIATELY	STANDARDS:	
CATEGORY:	X ON SPECIFIED FAILURE [[]] AGREEABLE TIME	LABOR: 0.5 Hours	
LOCATION	[[]] CUSTOMER INSTALLABLE	SERVICE [[]] RETURN	USED [[]] RETURN
CATEGORY:	[[]] ON-SITE	INVENTORY: [[]] SCRAP	PARTS: [[]] SCRAP
	X SERVICE CENTER	X SEE TEXT	X SEE TEXT
AVAILABILITY:	PRODUCT'S SUPPORT LIFE	AGILENT RESPONSIBLE UNTIL: February 2009	
AUTHOR: CH	PRODUCT LINE: WC		
ADDITIONAL INFORMATION:			

© AGILENT TECHNOLOGIES, INC. 2007 PRINTED IN U.S.A.



Page 2 of 2 E3641A-02

#### **Situation:**

1) When turning the knob of the power supply, user will find it difficult to adjust to get the desired setting (example of difficulty – user need a few turns to increase just a step of voltage/current).

2) Some times, by turning the knob clockwise to increase the voltage and current setting, user will see a decrease in values.

#### **Solution/Action:**

- 1) If the unit is confirmed having the problem described above (after verification steps), continue with Step 2. Otherwise, no further action is required.
- 2) Remove encoder (reference designator RE1) on the front panel display PCA. Replace with another encoder (refer to Picture 1 below).

