E3649A-03

SERVICE NOTE

Supersedes: NONE

E3649A DC Power Supply

Serial Numbers: MY40002859 / MY40003622

Difficulty to adjust the knob control on front panel due to encoder issue.

To Be Performed By: Agilent-Qualified Personnel

Parts Required:

P/N Description Qty.

0960-2545 Rotary encoder insulated shaft 1

ADMINISTRATIVE INFORMATION

SERVICE NOTE CLASSIFICATION:			
MODIFICATION RECOMMENDED			
ACTION CATEGORY:	[[]] IMMEDIATELY X ON SPECIFIED FAILURE [[]] AGREEABLE TIME	STANDARDS: LABOR: 0.5 Hours	
LOCATION CATEGORY:	[[]] CUSTOMER INSTALLABLE [[]] ON-SITE X SERVICE CENTER	SERVICE [[]] RETURN INVENTORY: [[]] SCRAP X SEE TEXT	USED [[]] RETURN PARTS: [[]] SCRAP X SEE TEXT
AVAILABILITY:	PRODUCT'S SUPPORT LIFE	AGILENT RESPONSIBLE UNTIL: February 2009	
AUTHOR: CH	PRODUCT LINE: WC		
ADDITIONAL INFORMATION:			

© AGILENT TECHNOLOGIES, INC. 2007 PRINTED IN U.S.A.



Page 2 of 2 E3649A-03

Situation:

1) When turning the knob of the power supply, user will find it difficult to adjust to get the desired setting (example of difficulty – user need a few turns to increase just a step of voltage/current).

2) Some times, by turning the knob clockwise to increase the voltage and current setting, user will see a decrease in values.

Solution/Action:

- 1) If the unit is confirmed having the problem described above (after verification steps), continue with Step 2. Otherwise, no further action is required.
- 2) Remove encoder (reference designator RE1) on the front panel display PCA. Replace with another encoder (refer to Picture 1 below).

