

INFORMATION ONLY – DOES NOT COMMUNICATE
A MODIFICATION OR SAFETY CONDITION

E4351B-01

S E R V I C E N O T E

Supersedes:
NONE

E4351B Solar Array Simulator

Serial Numbers: 0000A00000 / 9999Z99999

Situation:

A5 DSP board connector J-722 can become loose in transit.

Parts Required:

| P/N | Description | Qty. |
|------------|--------------------|-------------|
| NONE | | |

ADMINISTRATIVE INFORMATION

| |
|---|
| SERVICE NOTE CLASSIFICATION: INFORMATION ONLY |
| AUTHOR: RJM PRODUCT LINE: 33 |
| ADDITIONAL INFORMATION: |

© AGILENT TECHNOLOGIES, INC. 2002
PRINTED IN U.S.A.

July 23, 2002



Situation:

Connector J-722 / P-722 on the A5 DSP board can become loose in transit, and cause intermittent errors, the most frequent error being: "E8 SC RAM", this is at power-up.

Solution/Action:

To prevent the J-722 / P-722 connector from loosening, add a drop or two of silicone rubber adhesive to the connector pieces J-722 on A5 board, and P-722 on A6 connector board. Any suitable adhesive that can be easily removed may be used.