E4418B-22A

SERVICE NOTE

Supersedes: E4418B-22

E4418B EPM Power Meter

Serial Numbers: MY45107980 / MY45109728; SG45101519 / SG45102022

Power Meter Display Shrink

P	ar	ts	Re	a	uir	ed:	

P/N	Description	Qty.
E4418-60201	Front Panel Assembly for	1
	Agilent E4418B and	
	Agilent E4418B Option 002	
	OR	
E4418-60202	Front Panel Assembly for	1
	Agilent E4418B Option 003	
	OR	
E4418-61045	Front Panel Sub-assembly for	1
	Agilent E4418/19B	

ADMINISTRATIVE INFORMATION

SERVICE NOTE CLASSIFICATION:								
MODIFICATION RECOMMENDED								
ACTION CATEGORY:	X ON SPECIFIED FAILURE [[]] AGREEABLE TIME	STANDARDS LABOR: 0.5 Hours						
LOCATION CATEGORY:	X CUSTOMER INSTALLABLE [[]] ON-SITE X SERVICE CENTER [[]] CHANNEL PARTNER	SERVICE [[]] RETURN INVENTORY: [[]] SCRAP X SEE TEXT	USED [[]] RETURN PARTS: X SCRAP [[]] SEE TEXT					
AVAILABILITY:	PRODUCT'S SUPPORT LIFE	NO CHARGE AVAILABLE UNTIL: 31-March-2011						
AUTHOR: LCH		PRODUCT LINE: WC						
ADDITIONAL INFORMATION:								

© AGILENT TECHNOLOGIES, INC. 2010 PRINTED IN U.S.A.



June 28, 2010

Rev. 17 Page 1 of 4

Page 2 of 4 E4418B-22A

Situation:

Due to some issues with the implementation of new LCD display controller in the power meter's display, intermittent display shrink is observed when operating the power meter. This however doesn't impact all the units. The display shrink scenario may look like something shown below:



Solution/Action:

To resolve this problem, replace the front panel assembly with a good one. A good front panel has additional Transient Voltage Suppress (TVS) diode soldered on its PCA **OR** additional ribbon cable with Damping Resistors attached to it. The photos for good front panel assembly are shown below. Additional of TVS diode **OR** Damping Resistors will prevent the display shrink from happening.

Page 3 of 4 E4418B-22A

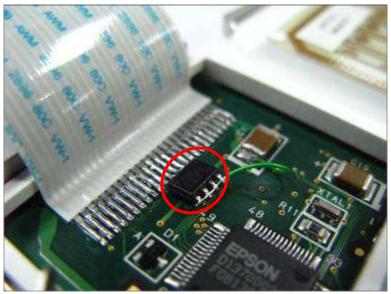


Figure 1

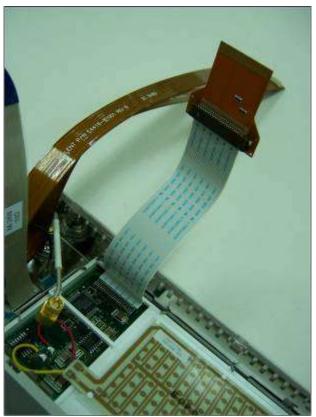


Figure 2

Page 4 of 4 E4418B-22A

Front panel with older version of LCD display controller can also be used to resolve this problem. For more information on old and new version of LCD display controller, please refer to service note E4418B-21A.