E4438C-23A

SERVICE NOTE

Supersedes: E4438C-23

E4438C Vector Signal Generator

Serial Numbers:

MY0000000/MY49071385, SG00000000/SG49070123 and US00000000/US47271002

Intermittent CPU boot-up and/or No display

Parts Required:	
P/N	Description

None

ADMINISTRATIVE INFORMATION

SERVICE NOTE CLASSIFICATION:				
MODIFICATION RECOMMENDED				
ACTION CATEGORY:	[X] ON SPECIFIED FAILURE [[]] AGREEABLE TIME	STANDARDS LABOR: 0.5 Hours		
LOCATION CATEGORY:	[X] CUSTOMER INSTALLABLE [[]] ON-SITE [X] SERVICE CENTER [[]] CHANNEL PARTNER	SERVICE [[]] RETURN INVENTORY: [[]] SCRAP [[]] SEE TEXT	USED [[]] RETURN PARTS: [[]] SCRAP [[]] SEE TEXT	
AVAILABILITY:	ALWAYS	NO CHARGE AVAILABLE UNTIL: 4/1/13		
AUTHOR: PY PRODUCT LINE		PRODUCT LINE: 15	NE: 15	
ADDITIONAL INFORMATION:				

Qty.

© AGILENT TECHNOLOGIES, INC. 2011 PRINTED IN U.S.A.

Agilent Technologies

Page 1 of 2

June 3, 2011

Rev. 18

Page 2 of 2 E4438C-23A

Situation:

The clock buffer, U7 on the A12 CPU board, part number E4400-60500 may cause intermittent boot up and/or no display when the instrument is powered up. It is recommended that this modification is performed on any instrument within the serial numbers above that exhibits an intermittent boot-up and/or a blank display.

Solution/Action:

Using the appropriate soldering technique and ESD station, perform a modification on the U7 circuit on the A12 CPU board. Connect U7 pin 8 to 3.4V (wire pin 8 to pin 4) and connect U7 pin 9 to DCOM (wire pin 9 to pin 12).

U7 modification procedure:

- 1. Refer to E4428C/38C Service Guide for the A12 CPU removal procedure.
- 2. Refer to Figure 1 for U7.
- 3. Use 30 AWG wire for wiring pin 8 to pin 4, and pin 9 to pin 12 per Figure 2.
- 4. Re-install CPU and cover.
- 5. Run self test.
- 6. No calibration is required.

Figure 1 U7 location – bottom side of the board.





