

E5061B-08

S E R V I C E N O T E

Supersedes:
NONE

E5061B Network Analyzer, 5 Hz to 3GHz

Serial Numbers: MY49100001 - MY49304840, SG49100001 - SG49300046

FW boot error due to option info not found

Parts Required:

P/N	Description	Qty.
NONE		

ADMINISTRATIVE INFORMATION

SERVICE NOTE CLASSIFICATION:	
INFORMATION ONLY	
<input type="checkbox"/> Calibration Required	PRODUCT LINE: WN
<input checked="" type="checkbox"/> Calibration NOT Required	AUTHOR: jm
ADDITIONAL INFORMATION:	

© AGILENT TECHNOLOGIES, INC. 2013
PRINTED IN U.S.A.

December 16, 2013

Rev. 21




Situation:


When D:\Agilent folder is deleted or moved to the incorrect place, FW which is below A.02.21 does not boot successfully.

Symptom-1

Symptom-2

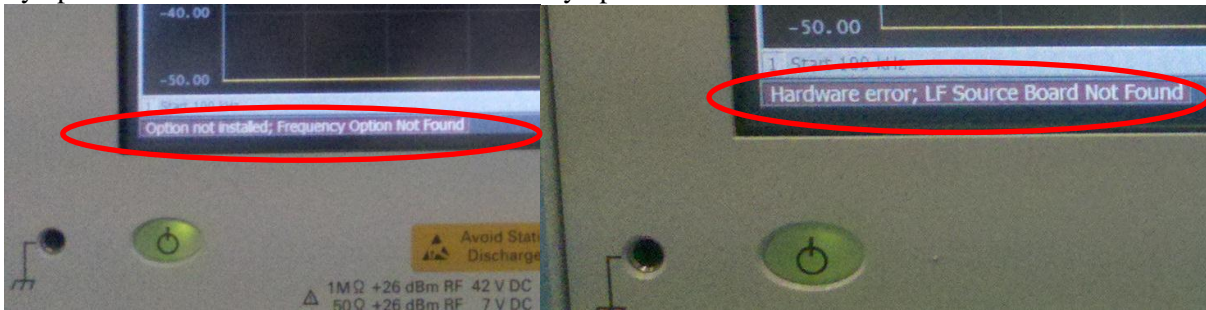

You can also see INVALID_DATA on Firmware Revision Info.

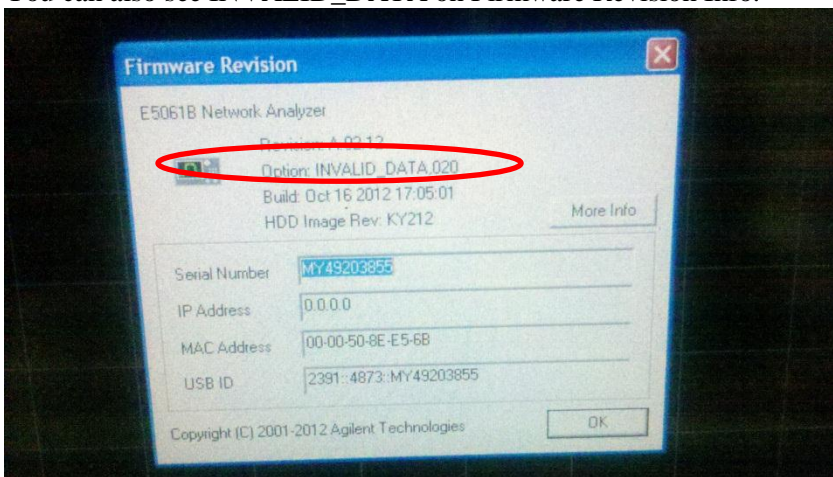

Solution/Action:

- Install FW A.02.21 or later.
- Then reboot the instrument.
- If no error is found, no more action is needed.
- If the same error is found, replace DSP board.

Revision History:

Revision Number	Date	Author	Reason For Change
E5061B-08	11-Dec-2013	jm	As published