E5071B-13

SERVICE NOTE

Supersedes: None

E5071B ENA Series Network Analyzer, 300 kHz to 8.5 GHz

Serial Numbers: MY42403787 – MY42404363, SG42400149 – SG42400156

"PLL Unlock" Error Message due to A21 Analog Interface Board Failure

To Be Performed By: Agilent-Qualified Personnel

Parts Required: See Solution/Action

P/NDescriptionQty.E5070-66521A21 ANALOG INTERFACE BOARD1

ADMINISTRATIVE INFORMATION

SERVICE NOTE CLASSIFICATION:			
MODIFICATION RECOMMENDED			
ACTION CATEGORY:	[[]] IMMEDIATELY X ON SPECIFIED FAILURE [[]] AGREEABLE TIME	STANDARDS: LABOR: 0.5 Hours	
LOCATION CATEGORY:	[[]] CUSTOMER INSTALLABLE [[]] ON-SITE X SERVICE CENTER	SERVICE [[]] RETURN INVENTORY: [[]] SCRAP [[]] SEE TEXT	USED [[]] RETURN PARTS: X SCRAP [[]] SEE TEXT
AVAILABILITY:	PRODUCT'S SUPPORT LIFE	AGILENT RESPONSIBLE UNTIL:	October, 2008
AUTHOR: jm	PRODUCT LINE: WN		_
ADDITIONAL INFORMATION:			

© AGILENT TECHNOLOGIES, INC. 2006 PRINTED IN U.S.A.



Page 2 of 2 E5071B-13

Situation:

If "PLL Unlock" was occurred, A1 Source board may be faulty as described in the service manual. But there are some units among the indicated serial numbers that shows "PLL Unlock" because of A21 Analog interface board failure.

Solution/Action:

Confirm whether "PLL Unlock" occurs or not with the following setups. If it occurs with one of them or both of them, it is caused by A21 failure. Replace A21 to new one.

Setup 1. (Start frequency = 1 GHz, Stop frequency = 1.05 GHz, Points = 401)

- 1-1. Press [Preset] Key
- 1-2. Press [Start], [1], and [G/n] key to set the start frequency as 1 GHz.
- 1-3. Press [Stop], and enter 1.05 and press [G/n] key to set the stop frequency as 1.05 GHz.
- 1-4. Press [Sweep Setup] key and "Points" soft key, enter 401 and press [x1] to set the point as 401.
- Setup 2. (Span = 0 Hz, Points = 1601)
 - 2-1. Press [Preset] key.
 - 2-2. Press [Span], [0], [x1] to set the sspan as 0 Hz.
 - 2-3. Press [Sweep Setup] key and "Points" soft key, enter 1601 and press [x1] to set the points as 1601.

⁻ End of Document -