MODIFICATION RECOMMENDED -CORRECTS MANUFACTURING OR DESIGN DEFECTS

# E5100A-31A <u>S E R V I C E N O T E</u>

Supersedes: E5100A-31

## E5100A Network Analyzer

Serial Numbers: JP4KC00577/JP5KC02722

#### Source Failure with Low or No Output Signal

To Be Performed By: Agilent-Qualified Personnel

Parts Required:	
-----------------	--

P/N	Description	Qty.	
E5100-66524	A24 Source Board Ass'y	1	

#### Situation:

Capacitors (10 uF) on the A24 Source board have been stressed in the board assembly manufacturing process, which may cause the capacitor to open. Source output level may drop or become no output due to an opened capacitor.

#### Solution/Action:

When the source output level is low or no output, a capacitor (10 uF) on the A24 board is most likely to have failed. Replace the A24 Source board (p/n E5100-66524).

### ADMINISTRATIVE INFORMATION

SERVICE NOTE CLASSIFICATION:				
MODIFICATION RECOMMENDED				
ACTION CATEGORY:	[[]] IMMEDIATELY X ON SPECIFIED FAILURE [[]] AGREEABLE TIME	STANDARDS: LABOR: 0.5 Hours		
LOCATION CATEGORY:	[[]] CUSTOMER INSTALLABLE [[]] ON-SITE X SERVICE CENTER	SERVICE [[]] RETURN USED [[]] RETURN INVENTORY: [[]] SCRAP PARTS: X SCRAP [[]] SEE TEXT [[]] SEE TEXT		
AVAILABILITY:	PRODUCT'S SUPPORT LIFE	AGILENT RESPONSIBLE UNTIL: December 2002		
AUTHOR: HH PRODUCT LINE: WN				
ADDITIONAL INFORMATION: Use 02G for the Repair Class and enter the PSSN number in the Repair Details SIS-Entry				

© AGILENT TECHNOLOGIES, INC. 2002 PRINTED IN U.S.A.



May 2, 2002