MODIFICATION RECOMMENDED -CORRECTS MANUFACTURING OR DESIGN DEFECTS

SERVICE NOTE

Supersedes: NONE

E5272A-01

E5272A 2 Channel Source Monitor Unit

Serial Numbers: JP10L00100/JP10L00105

SMU Modules may be Intermittently Unrecognized

To Be Performed By: Agilent-Qualified Personnel

Parts Required:		
P/N	Description	Qty.
E5281-00201	MPSMU module front panel	2

ADMINISTRATIVE INFORMATION

SERVICE NOTE CLASSIFICATION:			
MODIFICATION RECOMMENDED			
ACTION CATEGORY:	[] IMMEDIATELY [] ON SPECIFIED FAILURE [X] AGREEABLE TIME	STANDARDS: LABOR: 0.5 Hours	
LOCATION CATEGORY:	[] CUSTOMER INSTALLABLE [] ON-SITE [X] SERVICE CENTER	SERVICE [] RETURN USED [X] RETURN INVENTORY: [] SCRAP PARTS: [] SCRAP [X] SEE TEXT [] SEE TEXT	
AVAILABILITY:	PRODUCT'S SUPPORT LIFE	AGILENT RESPONSIBLE UNTIL: March, 2005	
AUTHOR: SY	PRODUCT LINE: 1H		
ADDITIONAL INFORMATION:			
© AGILENT TECHNOLOGIES, INC. 2003		. . .	

PRINTED IN U.S.A.



March 26, 2003

E5272A-01

Page 2 of 2

Situation:

The E5272A within the listed serial number range may have the problem that the installed SMU modules are intermittently unrecognized by CPU board (5272A). Typically, this problem disappears if you uninstall and reinstall the SMU modules.

Solution/Action:

When you repair or calibrate the E5272A, check the serial number and manufacturing date code (MDC) labeled on the SMU modules.

The improved SMU module has the MDC of 4307 or below as shown below. If the MDC is 4306 or above, replace the SMU front panel with improved one (p/n E5280-00201 and p/n E5281-00201).

E528x-xxxxx 33-xxxx xxxx-4307 MADE IN JAPAN

Prior to use the SMU modules and power supply module for repair, confirm that improved parts are used. If you find the parts apply to this service note in your support inventory, replace the front panel or cable guide. Then use the parts for the repair.