E8247C-01

S E R V I C E N O T E

Supersedes: None

E8247C PSG Analog Signal Generator

Serial Numbers:

E8247C: MY43000233 to MY43000280, MY43000001, MY43000173

Suspect part 5087-7061 serial numbers: 4843, 4846, 4849, 4852, 4855, 4857, 4858, 4859, 4860,

4869

The 5087-7061 (A30 Mod/Filter) serial numbers listed above have a potential reliability problem and should be replaced when the instrument is in the service center.

To Be Performed By: Agilent-Qualified Personnel or Customer

Parts Required:

P/N Description Qty.

5087-7061 A30 Mod/Filter

ADMINISTRATIVE INFORMATION

SERVICE NOTE CLASSIFICATION:			
MODIFICATION RECOMMENDED			
ACTION	[[]] IMMEDIATELY	STANDARDS:	
CATEGORY:	[]] ON SPECIFIED FAILURE	LABOR: Inspection .5 Hours	
		Replacement required 3 hrs	
	x AGREEABLE TIME		
LOCATION	[[]] CUSTOMER INSTALLABLE	SERVICE [[]] RETURN	USED x RETURN
CATEGORY:	[[]] ON-SITE	INVENTORY: [[]] SCRAP	PARTS: [[]] SCRAP
	x SERVICE CENTER	x SEE TEXT	[[]] SEE TEXT
AVAILABILITY:	PRODUCT'S SUPPORT LIFE	AGILENT RESPONSIBLE UNTIL: October 1, 2005	
AUTHOR: DMc	PRODUCT LINE: 15		
ADDITIONAL INFORMATION:			

© AGILENT TECHNOLOGIES, INC. 2003 PRINTED IN U.S.A.



Page 2 of 2 E8247C-01

Situation:

A FET used in the 5087-7061 assemble has the potential for an early failure. All suspect parts but those listed above were caught before being shipped.

Solution/Action:

When an E8247C a suspect serial number is returned to the service center for repair or calibration, remove the external cover and inspect the 5087-7061 serial number. Use the PSG Service Guide Replaceable Parts section to determine the location of the A30 Mod/Filter. If the A30 Mod/Filter microcircuit has a suspect serial numbers, replace the microcircuit under warranty. If the A30 Mod/Filter microcircuit serial number does not match one of the suspect serial numbers, do not replace the microcircuit.

Disposal: Clearly mark all suspect parts as "5087-7061 Service Note Replacement" and return the part using the BOPP process. In addition, send an email to "PGU, Sources" and title the email "5087-7061 Service Note Replacement". In the email include the instrument model and serial number and the microcircuit serial number.