J2523B-08

# SERVICE NOTE

SUPERSEDES: None

## J2523B LAN Advisor

Serial Numbers: EC Label less than code EC:10

### LAN select switch removal

**Duplicate Service Notes:** J2522B-08

#### Situation:

There are select switches on the J2523A/B Internet Advisors LAN CPU assembly that are not required, and are causing field failures. The select switches were installed to allow the selection of different I/O address, and AMD address. These addresses are fixed now and can not be changed, so we are removing the switches to improve the reliability of the product. If the J2523B suffers power on selftest failure Shared Memory = 2130, this modification may fix the failure without replacing the LAN CPU assembly. This modification is recommended for all Internet Advisor LAN products to improve the reliability.

#### Solution:

Remove the LAN CPU assembly from the chassis and locate the two select switches behind the DC power connector. The two 10 switch black banks of select switches need to be unsoldered and removed from the LAN CPU assembly. Once the switches are removed you need to use jumper wire to short pin 1 (the square pad for each bank of switches) to the required select lines. The bottom switch (switch Closest to the power connector) short pin 1 to pins 2, 3, 4, 9, and 11. The Top switch (switch farthest from the power connector) short pin 1 to pins 2, 3, 5, 8, 9, 10, 11.

DATE: June 1996

## ADMINISTRATIVE INFORMATION

SERVICE NOTE CLASSIFICATION:		
MODIFICATION RECOMMENDED		
ACTION CATEGORY:	<ul> <li>IMMEDIATELY</li> <li>ON SPECIFIED FAILURE</li> <li>AGREEABLE TIME</li> </ul>	STANDARDS: Labor 1.5 Hours
LOCATION CATEGORY:	<ul> <li>CUSTOMER INSTALLABLE</li> <li>ON-SITE</li> <li>SERVICE CENTER</li> </ul>	SERVICE RETURN USED RETURN INVENTORY: SCRAP PARTS: SCRAP SEE TEXT SEE TEXT
AVAILABILITY:	PRODUCT'S SUPPORT LIFE	AGILENT RESPONSIBLE UNTIL: August 1998
AUTHOR: RM	ENTITY: 3801	ADDITIONAL INFORMATION:

© 1996 AGILENT TECHNOLOGIES PRINTED IN U.S.A.

