S E R V I C E N O T E

SUPERSEDES: NONE

J2910A ATM DS3/E3 Plugin Module

Serial Numbers: US35350000 / US35350338

Framer Chip rev. "B" used on the digital board may cause erroneous E3 PLCP errors.

To Be Performed By: Agilent-Qualified Personnel

Parts Required:

P/N	Description	Quantity	
5063-6230	Digital Board	1	

Continued

DATE: August 1998

ADMINISTRATIVE INFORMATION

SERVICE NOTE CLASSIFICATION:				
MODIFICATION RECOMMENDED				
ACTION CATEGORY:	☐ IMMEDIATELY ☐ ON SPECIFIED FAILURE ☐ AGREEABLE TIME	STANDARDS: LABOR 0.7 Hours		
LOCATION CATEGORY:	☐ CUSTOMER INSTALLABLE☐ ON-SITE☐ SERVICE CENTER	SERVICE RETURN USED RETURN PARTS: SCRAP SEE TEXT		
AVAILABILITY:	PRODUCT'S SUPPORT LIFE	AGILENT RESPONSIBLE UNTIL: August 2000		
AUTHOR: NB	ENTITY: 0801	ADDITIONAL INFORMATION:		

© 1998 AGILENT TECHNOLOGIES PRINTED IN U.S.A.



Page 2 Service Note J2910A-01

Situation:

When Plugin module is accessed from top level, Internet Advisor, ATM Analysis, ATM Test Configuration and Simulate (loopback current interface)

Press: Start Press: Line Press: Stop Press: Config

Folder: Interface Protocol Set: Interface Type/E3 Press: Configuration

Set: Run Mode/Simulate Equipment Set: Framing/G.751 Press: OK

Connect: BNC cable from Equipment out to Line in

Press: Start

Test Conditions: PLCP BIP8/Equipment or Line=no count Test Conditions: PLCP FEBE/Equipment or Line=no count

Solution/Action:

Error Counts in PLCP BIP8/FEBE indicates erroneous readings. Digital board 5063-6230 needs to be changed. Visual inspect Brooktree parts, BT8222KPF(B/C/E), on the board. Last character "B" is a bad part for this application.