								J34	44A-	-01
S I	E R	V	Ι	С	Е		Ν	0	Т	E
						SUPER	SEDE	S: NON	IE	
J3444	A Fast F	Ethernet U	J nder	cradle						
Serial N	umbers: (J S 36420301	/ US36	421301						
	FI bracke ice Assei	et may cau mbly.	ise sh	ort on t	the J34	44A Ne	etwork			
To Be P	Performed	By: Agilent-	Qualif	ied Perso	nnel					
Parts R	equired:									
P/N		Description	n		Quant	У				
J3444-0	1201	RFI Bracke	et		1					
Situatio	on:									
board. T burn up	This excess on the Net	racket used o ive over hang work Interfac gh hole parts	g can ca e asser	ause a sho nbly. The	ort to gro e original	und, and l sheet me	will cau etal ove	ise the RI	FI bead to	
	n / Action:	_					-			
front par Undercr the botto side repl same pa	nel on the J radle, the to om side of t lace this de rt number s e bracket so	acket is the s 3444A. Visu p of the RFI the bracket. I fective RFI b so stock was o a visual ins	ually in bracket If the to pracket mixed i	spect the t (the side op side of with J344 in CMD-0	RFI Brac with not the brac 4-01201 C manufa	cket on ar tches cut ket is the . The ori acturing.	ny J3444 in it)sho same le iginal br Not all	4A Fast E ould be sh ongth as th cacket use units wil	Ethernet horter thar he bottom ed the l have the	l
						DATE:	Septe	mber 19	97	

ADMINISTRATIVE INFORMATION

SERVICE NOTE CLASSIFICATION:							
MODIFICATION RECOMMENDED							
ACTION CATEGORY:	☐ IMMEDIATELY ☐ ON SPECIFIED FAILURE ■ AGREEABLE TIME	STANDARDS: LABOR 0.5 Hours					
LOCATION CATEGORY:	☐ CUSTOMER INSTALLABLE ☐ ON-SITE ■ SERVICE CENTER	SERVICE RETURN USED RETURN INVENTORY: SCRAP PARTS: SCRAP SEE TEXT SEE TEXT SEE TEXT					
AVAILABILITY:	PRODUCT'S SUPPORT LIFE	AGILENT RESPONSIBLE UNTIL: Product's Support Life					
AUTHOR: RM ENTITY: 0801		ADDITIONAL INFORMATION:					

© 1997 AGILENT TECHNOLOGIES PRINTED IN U.S.A.

