

MODIFICATION RECOMMENDED –
CORRECTS MANUFACTURING OR DESIGN DEFECTS

SN J4630A-01

S E R V I C E N O T E

Supersedes:
NONE

J4630A VQT Undercradle

Serial Numbers: [0000A00000 / 9999Z99999]

Updated replacement of analog card for improved PESQ scores

To Be Performed By: Agilent-Qualified Personnel

Parts Required:

P/N	Description	Qty.
5065-9791	Exchange FXO EM bd.	1

ADMINISTRATIVE INFORMATION

SERVICE NOTE CLASSIFICATION:			
MODIFICATION RECOMMENDED			
ACTION CATEGORY:	<input type="checkbox"/> IMMEDIATELY <input checked="" type="checkbox"/> ON SPECIFIED FAILURE <input type="checkbox"/> AGREEABLE TIME	STANDARDS: LABOR: 1.5 Hours	
LOCATION CATEGORY:	<input type="checkbox"/> CUSTOMER INSTALLABLE <input type="checkbox"/> ON-SITE <input checked="" type="checkbox"/> SERVICE CENTER	SERVICE INVENTORY: <input checked="" type="checkbox"/> RETURN <input type="checkbox"/> SCRAP <input type="checkbox"/> SEE TEXT	USED PARTS: <input type="checkbox"/> RETURN <input type="checkbox"/> SCRAP <input type="checkbox"/> SEE TEXT
AVAILABILITY:	PRODUCT'S SUPPORT LIFE	AGILENT RESPONSIBLE UNTIL: April 2004	
AUTHOR: DM	PRODUCT LINE: 2J		
ADDITIONAL INFORMATION:			

© AGILENT TECHNOLOGIES, INC. 2002
PRINTED IN U.S.A.




March 28, 2002

Situation:

Adapting the Infineon ALIS FXO chipset for use in the E&M ports of the analog board results in extra circuit noise. This limits the maximum PESQ scores. Replacing this board with the modified assembly reduces the circuit noise and improves the possible PESQ scores when using the E&M ports .

Solution/Action:

Replace the analog FXO E&M card with the latest version. This, along with downloading the VQT application Software Version 4.1.1 or later. When the “defective” analog card is removed the metal grounding tab MUST be swapped to the new assembly.

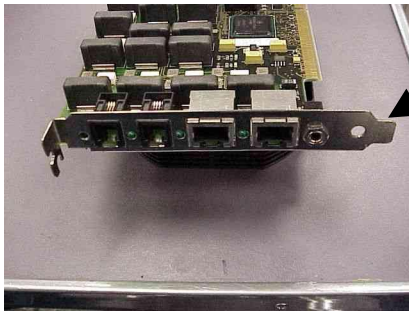

Move metal tab to
new assembly.