

INFORMATION ONLY – DOES NOT COMMUNICATE
A MODIFICATION OR SAFETY CONDITION

SN J6801A-05

S E R V I C E N O T E

Supersedes:
None

J6801A DNA

Serial Numbers: [0000A00000 / 9999Z99999]

If it is necessary to replace the System board stack be aware there are 2 different part numbers depending on the EC revision of the unit .

Parts Required:

P/N	Description	Qty.
------------	--------------------	-------------

ADMINISTRATIVE INFORMATION

SERVICE NOTE CLASSIFICATION:

INFORMATION ONLY

AUTHOR: DM PRODUCT LINE: 2J

ADDITIONAL INFORMATION:

© AGILENT TECHNOLOGIES, INC. 2006
PRINTED IN U.S.A.




January 9, 2006

Situation:

The model number J6801A can contain either of two board stack assemblies. Those units with a revision label prior to EC 13:14 were built with PN 5065-9796. The “refurbished” PN is 5067-0091. Those units of revision EC13:14 and beyond were built with PN 5067-2344 as the board stack assembly. These units also use a 12V fan system in place of the 5V fans used in the earlier versions.

Solution/Action:

The 5065-9796 is no longer available and has been replaced by the 5067-2344. The 5067-2344 can be used to repair the J6801A of all revisions, so it is backwards compatible to the 5065-9796. HOWEVER, the 5067-0091 cannot be used to repair a unit with revision EC 13:14 or later. The new refurbished PN is 5067-2345. Note that this assembly still maintains the connectors for 5V fan operation. (See photos) 12 V fan connections for EC13:14 and beyond.

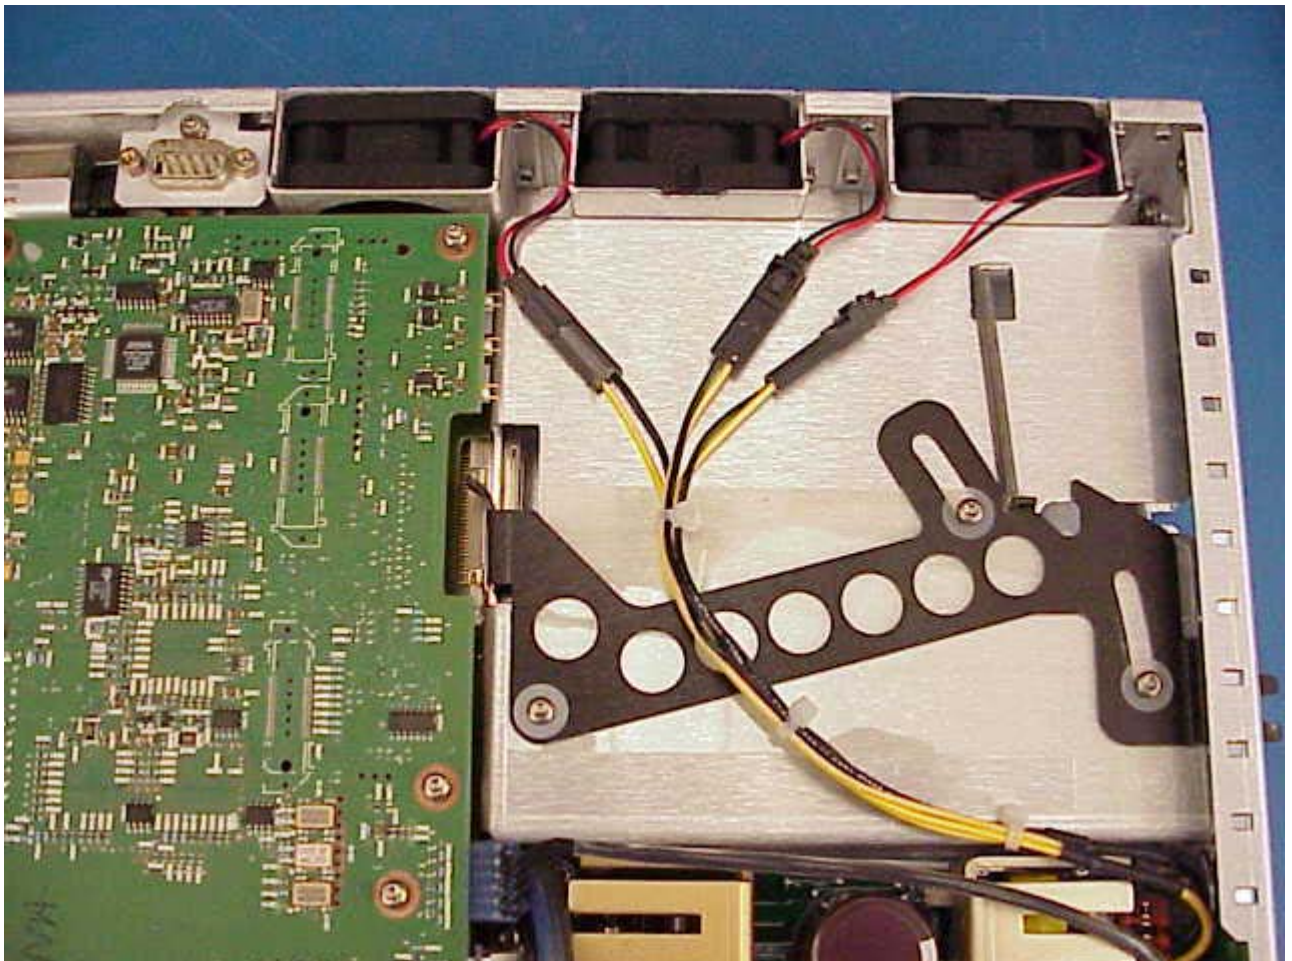

Shown here are the 5V fan connections.

