M1740A-02

Modification Recommended Service Note

Supersedes: [NONE]

M1740A - mmWave Transceiver for 5G

Serial Numbers: US00000000 - US99999999 and MY00000001 - MY59291000

Problem – Center pin of External trigger connector breakage. Add the M1740-20034 RF support bracket to hold the External trigger cable and prevent the center pin breakage.

Parts Required:

 P/N
 Description
 Qty.

 M1740-20034
 RF support
 1

 0515-0380
 T20, M4x0.7 10mm long screw
 2

 1250-4492
 SMP to SMA adaptor
 1

ADMINISTRATIVE INFORMATION

ACTION	[]] ON SPECIFIED FAILURE	STANDARDS		
CATEGORY:	[X] AGREEABLE TIME	LABOR: 0.5 Hours		
LOCATION CATEGORY:	[[]] CUSTOMER INSTALLABLE [[]] ON-SITE (active On-site contract required) X SERVICE CENTER [[]] CHANNEL PARTNERS	SERVICE: [[]] RETURN USED [[]] RETURN INVENTORY: [[]] SCRAP PARTS: [[]] SCRAP [[]] SEE TEXT [[]] SEE TEXT		
AVAILABILITY	: PRODUCT'S SUPPORT LIFE	NO CHARGE AVAILABLE UNTIL: 21 February 2022		
[[]] Calibration Required X Calibration NOT Required		PRODUCT LINE: PL13 AUTHOR: MW		

ADDITIONAL INFORMATION:



Situation:

Problem = External Trigger cable connected to the M1740A external trigger connection puts stress on the center pin and breaks.

Solution/Action:

Add the M1740-20034 RF support bracket to hold the External trigger cable and prevent the stress on the External trigger connector center pin. Prevent breakage.

Add the following parts to the side of the M1740A when returned to service center for calibration and/or repair.

Part Number	Description	Qty.
M1740-20034	RF support	1
0515-0380	T20, M4x0.7 10mm long screw	2
1250-4492	SMP to SMA adaptor	1



Revision History:

Date	Service Note Revision	Author	Reason for Change
19 February 2020	01	Michael Woichik	As Published