M9505A-08

Modification Recommended Service Note

Supersedes: NONE

M9505A AXIe 5-Slot Chassis

Serial Numbers: TW61130001 - TW61410050

System unable to boot up and the green LED status keeps blinking.

Parts Required:

P/N Description Qty.

NONE. See instructions below.

ADMINISTRATIVE INFORMATION

ACTION X ON SPECIFIED FAILURE CATEGORY: [[]] AGREEABLE TIME	STANDARDS LABOR: 0.5 Hours
LOCATION X CUSTOMER INSTALLABLE CATEGORY: [[]] ON-SITE (active On-site contract required)	SERVICE: X RETURN USED X RETURN INVENTORY: [[]] SCRAP [[]] SEE TEXT [[]] SEE TEXT
AVAILABILITY: PRODUCT'S SUPPORT LIFE	NO CHARGE AVAILABLE UNTIL: 12/01/2022
[[]] Calibration Required X Calibration NOT Required	PRODUCT LINE: BL AUTHOR: TP

ADDITIONAL INFORMATION:



Situation:

At power up of the system with the affected chassis using with ESM M9505-00133 or M9505-00233, the system would not fully boot. The status LED of the ESM keeps flashing green. The modules installed are not enumerating and showing Fail LED with solid red.

Solution/Action:

Upgrade the chassis and ESM firmware to version 2.1.4 or greater. Refer to M9502A and M9505A AXIe Chassis Firmware for detail on how to upgrade. This FW 2.1.4 can only be used with ESM M9505-00133, M9505-00233, or greater. DO NOT upgrade to this FW version if you are using ESM M9505-00132, M9505-00232 or older.

Revision History:

Date	Service Note Revision	Author	Reason for Change	
03 Nov 2021	01	TP	As Published	