

M9505A-08A

Modification Recommended Service Note

Supersedes: M9505A-08

M9505A AXIe 5-Slot Chassis

Serial Numbers: TW61130001 - TW61410050

System unable to boot up and the green LED status keeps blinking.

Parts Required:

P/N Description Qty.

NONE. See instructions below.

ADMINISTRATIVE INFORMATION

| ACTION CATEGORY: | X ON SPECIFIED FAILURE [[]] AGREEABLE TIME | STANDARDS LABOR: 0.5 Hours |
|-----------------------|--|---|
| LOCATION CATEGORY: | X CUSTOMER INSTALLABLE [[]] ON-SITE (active On-site contract required) X SERVICE CENTER [[]] CHANNEL PARTNERS | SERVICE: X RETURN USED X RETURN INVENTORY: [[]] SCRAP PARTS: [[]] SCRAP [[]] SEE TEXT [[]] SEE TEXT |
| AVAILABILITY | : PRODUCT'S SUPPORT LIFE | NO CHARGE AVAILABLE UNTIL: 12/01/2022 |
| | [[]] Calibration Required X Calibration NOT Required | PRODUCT LINE: BL AUTHOR: TP |

ADDITIONAL INFORMATION:



Situation:

At power up of the system with the affected chassis using with ESM M9505-00133 or M9505-00233, the system would not fully boot. The status LED of the ESM keeps flashing green. The modules installed are not enumerating and showing Fail LED with solid red.

Solution/Action:

Upgrade the chassis and ESM firmware to version 2.1.5 or greater. Refer to **M9502A and M9505A AXIE Chassis Firmware** for detail on how to upgrade. This FW 2.1.5 can only be used with ESM M9505-00133, M9505-00233, or greater. DO NOT upgrade to this FW version if you are using ESM M9505-00132, M9505-00232 or older.

Revision History:

| 03 Nov 2021 01 TP As Published | Date | Service Note Revision | Author | Reason for Change |
|-------------------------------------|-------------|-----------------------------|--------|-------------------|
| | 03 Nov 2021 | 01 | TP | As Published |
| 11 Apr 2022 02 TP Update FW version | 11 Apr 2022 | 02 | TP | Update FW version |