Modification Recommended Service Note

Supersedes: MSOS104A-03D

MSOS104A – MSO Infiniium S Series 1GHz 4 channel

Serial Numbers: MY00000001 - MY58060101; SG54360101, SG55020101, SG55020102, SG55510101 to SG55510111, SG57130101, SG58060101, SG58060102, SG58150101 to SG58150106

The Problem – Under certain circumstances a PLL2 error may occur on the S-series products.

Parts Required: P/N Description	Qty.
54911-69511 PCA – Acquisition Board (tested)	1
54911-69521 PCA – Acquisition Board (tested)	1
54911-69531 PCA – Acquisition Board (tested)	1
54911-69532 PCA – Acquisition Board (tested)	1

ADMINISTRATIVE INFORMATION

ACTION	[X] ON SPECIFIED FAILURE	STANDARDS
CATEGORY:	[]] AGREEABLE TIME	LABOR: 4.0 Hours
LOCATION CATEGORY:	[X] SERVICE CENTER [[]] ON-SITE (active On-site contract required) [[]] CHANNEL PARTNERS	SERVICE: [X] RETURN USED [X] RETURN INVENTORY: [[]] SCRAP PARTS: [[]] SCRAP [[]] SEE TEXT [[]] SEE TEXT
AVAILABILITY	(: PRODUCT'S SUPPORT LIFE	NO CHARGE AVAILABLE UNTIL: December 31, 2023
	[X] Calibration Required [[]] Calibration NOT Required	PRODUCT LINE: PL-1A AUTHOR: EG

ADDITIONAL INFORMATION:



Situation:

On older acquisition boards a PLL2 error message sometimes occurs. The error message appears on the screen as below:



There are new acquisition boards that fix this issue for the S-series scopes.

Solution/Action:

Please, use the 54911-69511 board until is gone. If you have a 54911-69511, then skip steps 1 and 2 and proceed to step 3. If there are no 54911-69511, then start with step 1 below.

- 1. If the customer needs to have software revision < 6.10.01001, then replace the acquisition board with the 54911-69532 board.
- 2. If the customer can have software revision >= 6.10.01001, then it can be replaced by any of these three boards: 54911-69521, 54911-69531, or 54911-69532.

- 3. Save the Serial Numbers of the replaced and the new Acquisition Boards in Siebel. Please, follow this procedure:
 - a. For each Service Order in Siebel, there is a tab labeled Activities:

Activities	Menu 🔻 Query				
Activity #	Туре	Billing Type	Planned Start	Duration	Status
1-40WC9AU	Logistics	Not Billable	3/22/2017 12:20:53		Done
1-40WC9AX	Repair-Inc post C	Factory Warranty	3/22/2017 12:20:53		Done

b. Clicking on the Activity # associated with the Repair, you'll see this:

More Info	Attachments	Assign	Contacts Emplo	oyees Tools	Charges	Items	Messages	Time	Logistics
Menu 🔻	New	Juery							
Туре	Date		Labor Item Number	Quoted Time	Elapse	d Time	Reported	Time	Original L
Standard Time	e 4/18/20	17	RLR5A		4.00		4.00		
Standard Time	e 4/18/20	17	RLR5C		1.50		1.50		

c. Click on the Items tab to enter or see the parts that were ordered and/or used:

More Info	Attachments Assign	Contacts Employee	ts Tools	Charges Items	Messages	Time	Log
Menu 🔻	New Query Split	Line					
Part #	Product Description	Alternate Product Des	Qty	Original List Pri	ce Extende	d Amount	t.
16800-68702	Power supply subas	s Netzteil Untereinhe	1		_		
0950-4822	Power Supply 15-W	A	1				
0960-2875	NFTS; Mod and Ser	N	1				
0960-2939	Mod and Ser Nbr Re	90	1				

d. Somewhere in the parts record you'll find the serial number fields (Old Serial Number, and New Serial/Mfg Id)

New Serial/Mfg Id	Planned Date	Return Ship Date	Tracking #	Location	Product Line	Line Comment	Include in Billable Tot	Old Serial Number	Refer
	4/12/2017 09:47:11				8T		~		
•	4/6/2017 17:23:31				8T		~		
	4/12/2017 10:32:47				8T		~		
	4/10/2017 16:34:16				8T		~		

e. The fields can be re-ordered in Siebel so that they are more easily found – like this:

More Info At	tachments Assign	Contacts Employee	es Tools	Charges Items Me	ssages Time	Logistics A	udit Trail CFD Language	
Menu 💌	New Query Split L	ine						
Part #	Product Description	Alternate Product Des	Qty	Parts Fail Code	Old Serial Numb	er Return To	New Serial/Mfg Id	Origi
16800-68702	Power supply subass	Netzteil Untereinhe	1	Defective Assembl.		Distribution	Center	_
0950-4822	Power Supply 15-WA	1	1	Assembly/Part Not		Distribution	Center	
0960-2875	NFTS; Mod and Ser I		1	Assembly/Part Not.		Distribution	Center	
0960-2939	Mod and Ser Nbr Red		1	Assembly/Part Not.		Distribution	Center	

NOTE: The fields only take 19 characters. The acq board serial numbers are 24 characters. Please do not enter the "54911" portion of the serial numbers (the first 5 numbers) in the fields; enter only the remaining 19 characters.

Adding the serial numbers of both the failed (replaced/old) Acquisition Board and the new Acquisition Board in these fields will allow us to more easily find them in Siebel and Spotfire.

4. Return the failed acquisition board to the factory.

Revision History:

Date	Service Note Revision	Author	Reason for Change	
30 Jan 2018	03	Ed Gorbea	As Published	
18 Apr 2018	03A	Ed Gorbea	New acquisition board	
28 Feb 2019	03B	Ed Gorbea	More new acquisition boards	
24 Apr 2019	03C	Ed Gorbea	Adding 54911-66/69511 board	
14 Oct 2019	03D	Ed Gorbea	Adding the SGXXXXXXX models	
14 Mar 2023	03E	Ed Gorbea	Extending no charge available date	