

N2830A-01

Modification Recommended Service Note

Supersedes: NONE

N2830A 4 GHz InfiniiMax III+ Series Probe Amplifier

Serial Numbers: US0000000 / US57270000

[The Problem – Probes are showing an unstable offset. This can be evident when user wiggles the probes cable while observing the offset movement on the scope screen.

Parts Required:

P/N	Description	Qty.
0515-5534	Screw-Set with Cup-Point HEX-Socket M3X0.5 3mm-LG SST 18-8	1
N2830-94305	Pod product label	1

ADMINISTRATIVE INFORMATION

ACTION CATEGORY:	[]] ON SPECIFIED FAILURE X AGREEABLE TIME	STANDARDS LABOR: 1.5 Hours		
LOCATION CATEGORY:	[[]] CUSTOMER INSTALLABLE [[]] ON-SITE (active On-site contract required) X SERVICE CENTER [[]] CHANNEL PARTNERS	SERVICE: []] RETURN USED [[]] INVENTORY: []] SCRAP PARTS: X S []] SEE TEXT []]	RETURN SCRAP SEE TEXT	
AVAILABILITY: PRODUCT'S SUPPORT LIFE		NO CHARGE AVAILABLE UNTIL: August 31, 2018		
X Calibration Required [[]] Calibration NOT Required		PRODUCT LINE: PL1A AUTHOR: MRR		

ADDITIONAL INFORMATION: N283XA probes that are US57280000 or later have this modification done at the time of manufacturing.



Situation:

Some N2830A,N2831A, and N2832A probes can show an unstable offset on scope screen. This issue can be screened by wiggling the cable of the probe amplifier and observing the movement on screen.

Solution/Action:

Replace the current set screw under the product label to ensure cable ground connection to BNC ground.

Upgrade instructions:

The set screw is underneath the product number label. You must remove the label in order to get to the set screw. Using a wood stick, remove any adhesive residue.

Caution

Be careful NOT to scratch or chip the housing with tweezers.



If the set screw is not stainless, it looks like the following after the sticker has been removed:

- a. If the screw is stainless, then remove adhesive and replace the label.
- b. No need to re-calibrate.
- c. If screw is black remove screw using T6 Torx.





Below is what the new set screw should look like when inside the probe.



Install screw 0515-5534 Tighten T6 to 18 in oz.





Test the BNC connector by rotating the wing latch clockwise, and verify the BNC tab rotates inside the pod housing.



BNC tab rotates with BNC latch rotation

Rotate the BNC wing latch all the way counterclockwise. Release the latch to verify the BNC tab rotates back to its original position.



Replace label

Use the table to determine which label to use:

Model No.	Part No.	Bandwidth	Label Part No.
N2830A	N2830A-FG	4 GHz	N2830-94305
N2831A	N2831A-FG	8 GHz	N2831-94305
N2832A	N2832A-FG	13 GHz	N2832-94305

Locate the Pod Product Label (SD107). Verify the **model number** on the Pod product label matches the **model number** printed on the silver Pod SN label in the recessed area of the Pod lower housing.



6

Recalibrate probe and issue new calibration certificate.

REPACKAGE THE COMPLETED ASSEMBLIES *** END OF PROCEDURE ***

Revision History:				
Date	Service Note Revision	Author	Reason for Change	
3 August 2017	01	Mark Rowley	As Published	
07/090312017	01	Mark Kowley		