

N5221A-03

Information Only Service Note

Supersedes:
None

PNA Network Analyzers

Serial Numbers: ALL serial numbers with hard disk drive version: S.28.03.05

GPIB0 has an incorrect Visa Interface ID. Agilent Connection Expert shows GPIB1 and this will cause the Service Adjustments to fail

Parts Required:

NONE

NOTICE: This document contains references to Agilent Technologies. Agilent's former Test and Measurement business has become Keysight Technologies. For more information, go to www.keysight.com.



ADMINISTRATIVE INFORMATION

Calibration NOT Required

PRODUCT LINE: PLWN

AUTHOR: KS

ADDITIONAL INFORMATION:

Affects: N5221A, N5222A, N5224A, N5225A, N5227A, N5231A, N5232A, N5234A, N5235A, N5239A, N5241A, N5242A, N5244A, N5245A, N5247A, N5249A, N5264A



Situation:

GPIB0 has an incorrect Visa Interface ID. Agilent Connection Expert shows GPIB1 and this will cause the Service Adjustments to fail

Solution/Action:

- a. Open a command prompt as administrator
 - Start > All Programs > Accessories > “right mouse click on Command Prompt and run as administrator”
- b. In the Command Prompt window type the following
 - C:\Agilent\Drivers\Common\vnaiocconfig.exe
- c. The vnaiocconfig.exe program will run and make the necessary changes to Agilent I/O libraries.
- d. A reboot of the PNA is needed.

Revision History:

| Date | Service Note Revision | Author | Reason for Change |
|-------------|-----------------------|--------------|-------------------|
| 21 Oct 2015 | 01 | Keith Stengl | As Published |
| | | | |
| | | | |
| | | | |
| | | | |
| | | | |
| | | | |
| | | | |
| | | | |